



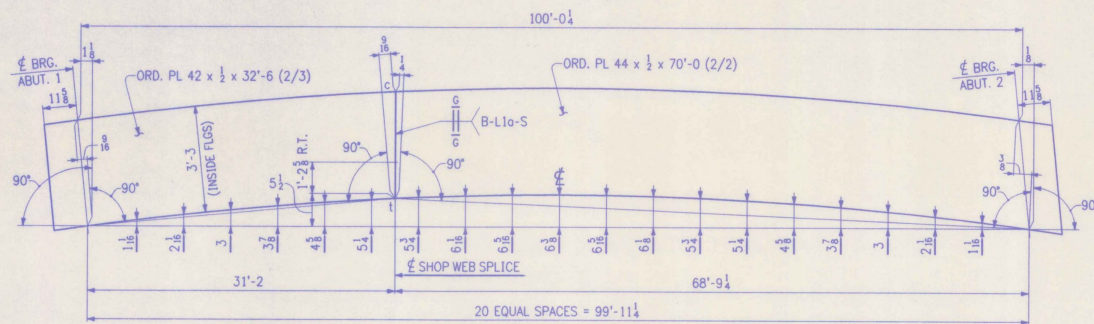

CAMBER DIAGRAM FOR G1A

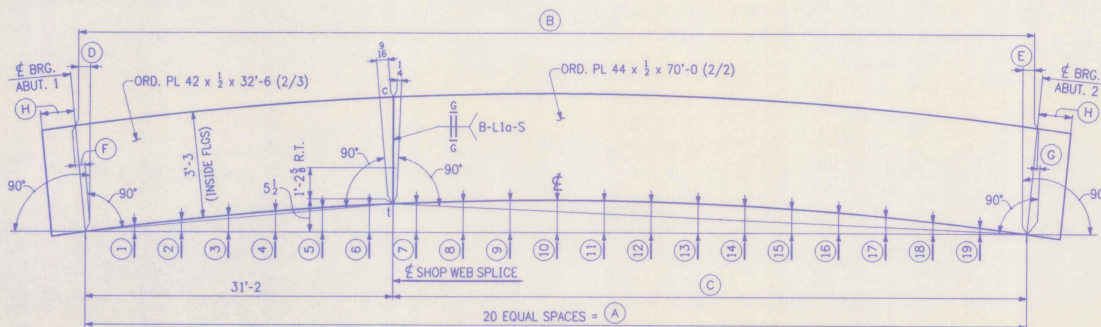

CAMBER DIAGRAM FOR G2A THRU G6A

MARK	(A)	(B)	(C)	(D)	(E)	(F)	(G)	(H)	(1)	(2)	(3)	(4)	(5)	(6)	(7)	(8)	(9)	(10)	(11)	(12)	(13)	(14)	(15)	(16)	(17)	(18)	(19)
G2A	99'-10 7/16	99'-11 8/16	68'-8 7/16	1 1/8	0	8/16	1/4	1'-0																			
G3A	99'-10 1/16	99'-11 1/16	68'-8 1/16	1 1/8	0	1/2	1/4	1'-0 1/4	1 1/8	2 1/8	3 1/8	4	4 3/8	5 1/8	5 1/2	6 1/8	6 3/8	6 5/8	6 7/8	6 9/8	6 11/8	6 13/8	6 15/8	6 17/8	6 19/8	6 21/8	6 23/8
G4A	99'-9 15/16	99'-11	68'-7 15/16	1"	1/16	7/16	3/8	1'-0 1/4																			
G5A	99'-10 1/8	99'-11 1/4	68'-8 1/8	1"	1/8	7/16	1/2	1'-0 1/4																			
G6A	99'-10 3/8	99'-11 1/8	68'-8 3/8	1 1/8	1/8	3/8	1/2	1'-0	1 1/8	2 1/8	3	3 1/8	4 1/8	5 1/8	5 1/2	6 1/8	6 1/4	6 1/2	6 1/4	6	5 1/8	5 3/8	4 9/8	3 13/8	2 17/8	2	1 1/8

NOTES:

1. FOR GENERAL SHOP NO.
2. THE LETTERS "L" & "C" AND COMPRESSION R
3. R.T. DEPTH ON WEB PL WEB DEPTH PLUS 25% RADIOGRAPHICALLY TE
4. ALL WEB PLATES REQU

△	
△	
△	
NO.	

HIGH STEEL STR

V
U

TOWN OF

A

STATE CONTRACT PR

OR REF. NO.

CONTRACTOR J. A.

IN CHARGE abs

CONTRACT VT-9

CODE: 30