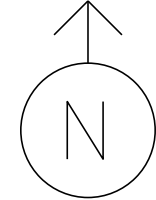


MS # 506



US-7 NORTH

HARBOR ROAD

- ⊙ PEDESTAL POST
- Ⓟ→ PEDESTRIAN SIGNAL
- ⊥ L.E.D REGULATORY SIGN
- ⊠ CONTROL BOX
- - - LOOP DETECTION
- JB JUNCTION BOX
- A =
- B =
- C =
- R =

STOP

8

8

FALLS ROAD

US-7 SOUTH

NOT TO SCALE

4

9

1 B

8

8

C

C

4

R

4

Ⓟ

⊙

JB

Ⓟ

⊙

5 B

2

5

2

ONLY



ONLY



MS # 506

N

US-7 NORTH

HARBOR ROAD

11' 10' 11'

LANE LINE 90'

ONLY



STOP BAR 22'

STOP

15'

17'

CROSSWALK 47'

STOP BAR 17'

STOP BAR 23'

CROSSWALK 50'

LANE LINE 65'

12'

11'

CROSSWALK 40'

15'

STOP BAR 22'



ONLY

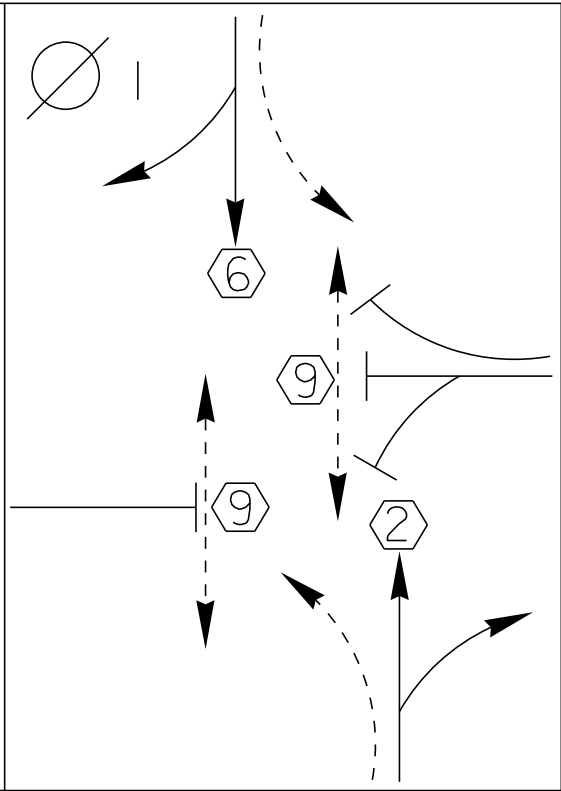
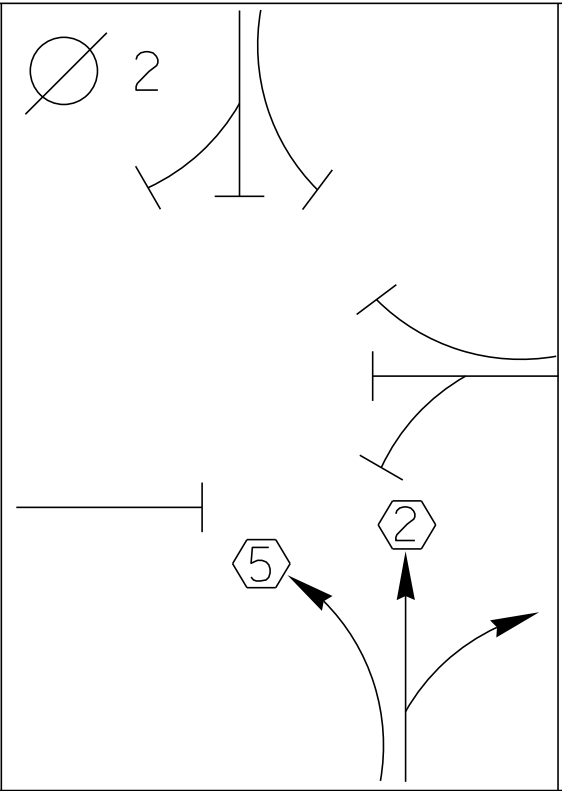
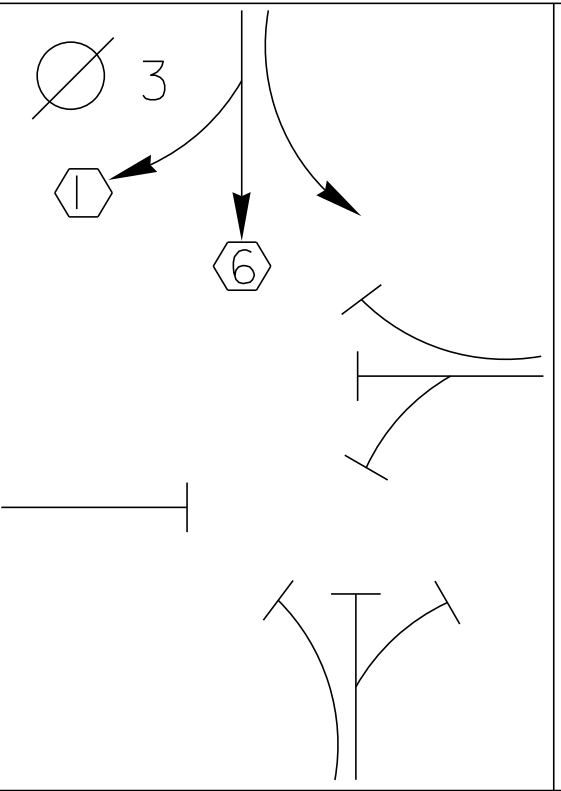
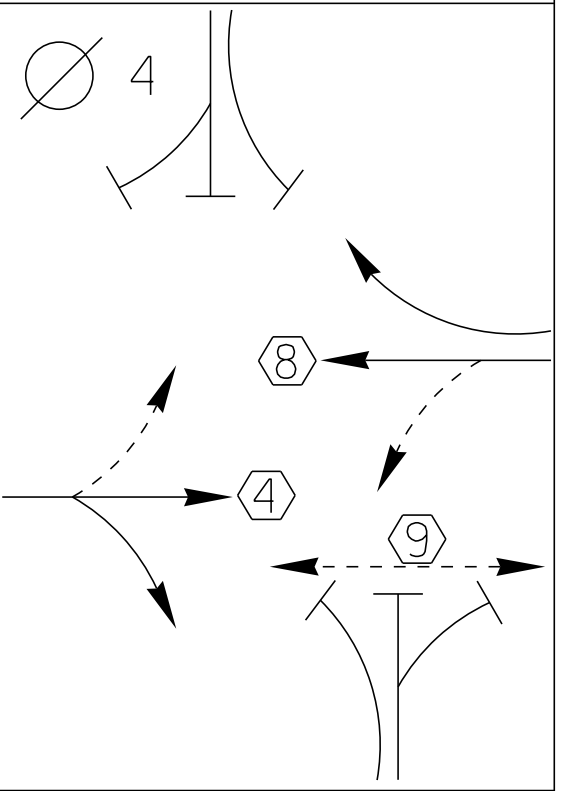
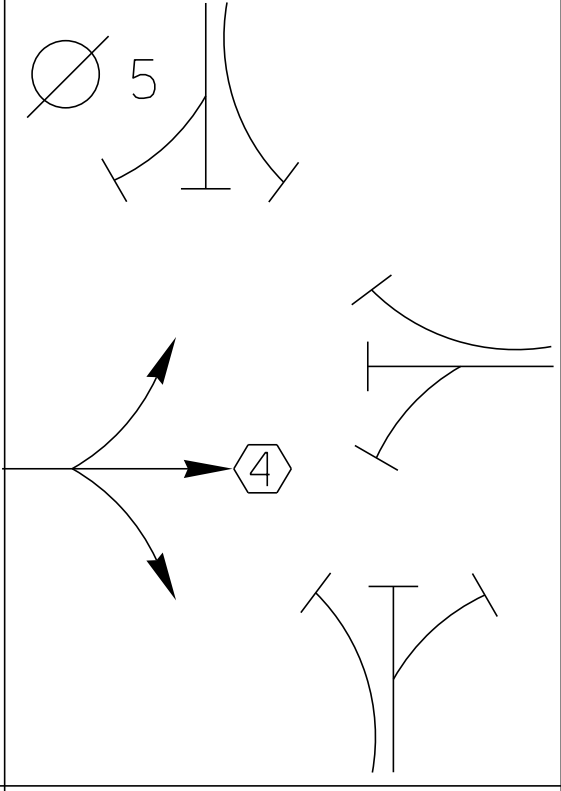
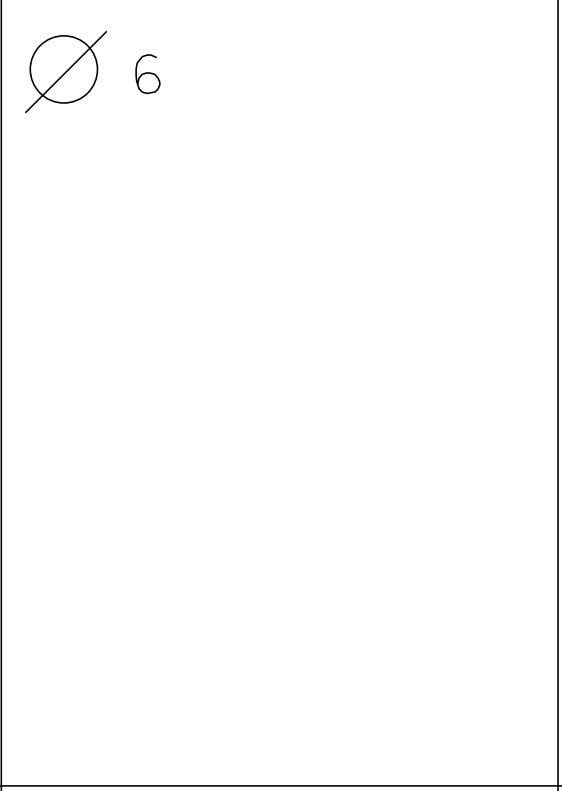
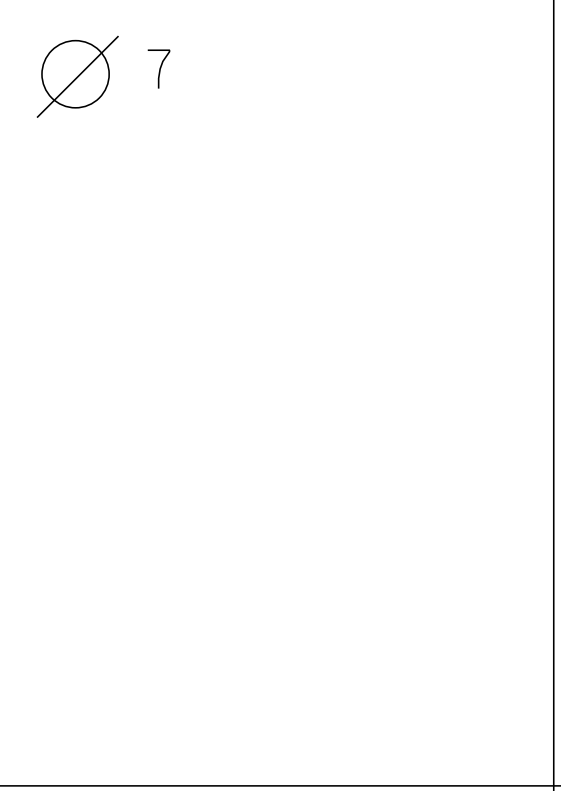
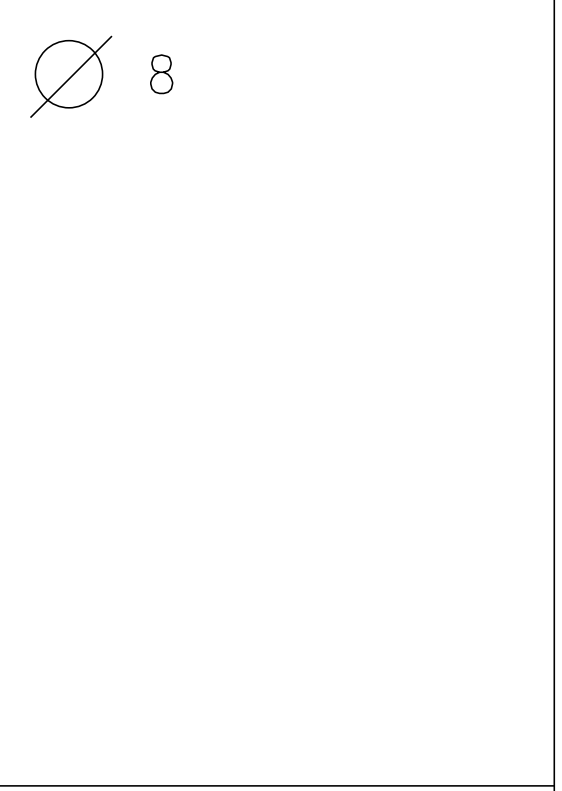
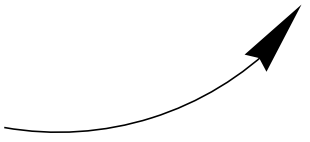
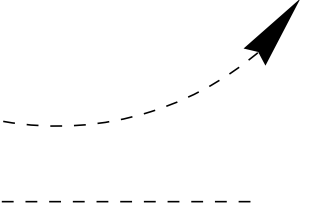
LANE LINE 90'

11' 11' 11'

US-7 SOUTH

FALLS ROAD

NOT TO SCALE

D I A G R A M N ↑				
TIMING	G = Y =	G = Y =	G = Y =	G = Y =
D I A G R A M				
TIMING	G = Y =	G = Y =	G = Y =	G = Y =
 PROTECTED TURNS	 PERMITTED TURNS PEDESTRIAN	CYCLE LENGTH, C= _____ S		

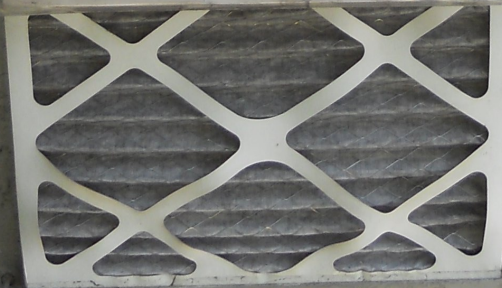
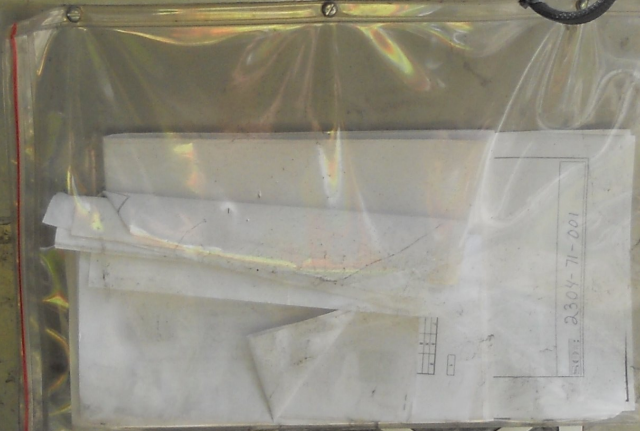


DANGER

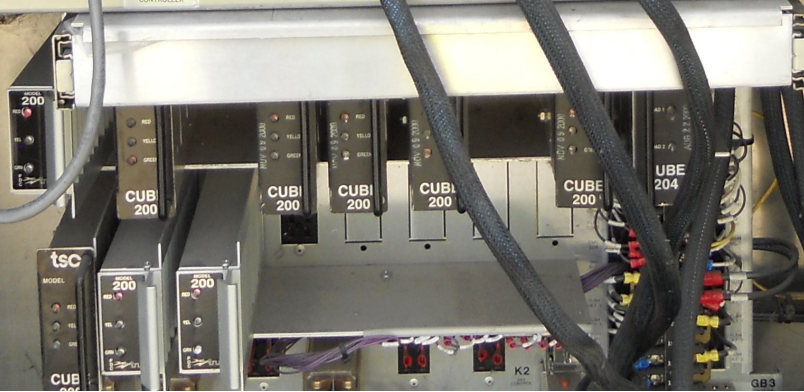
115 VOLTS A.C.

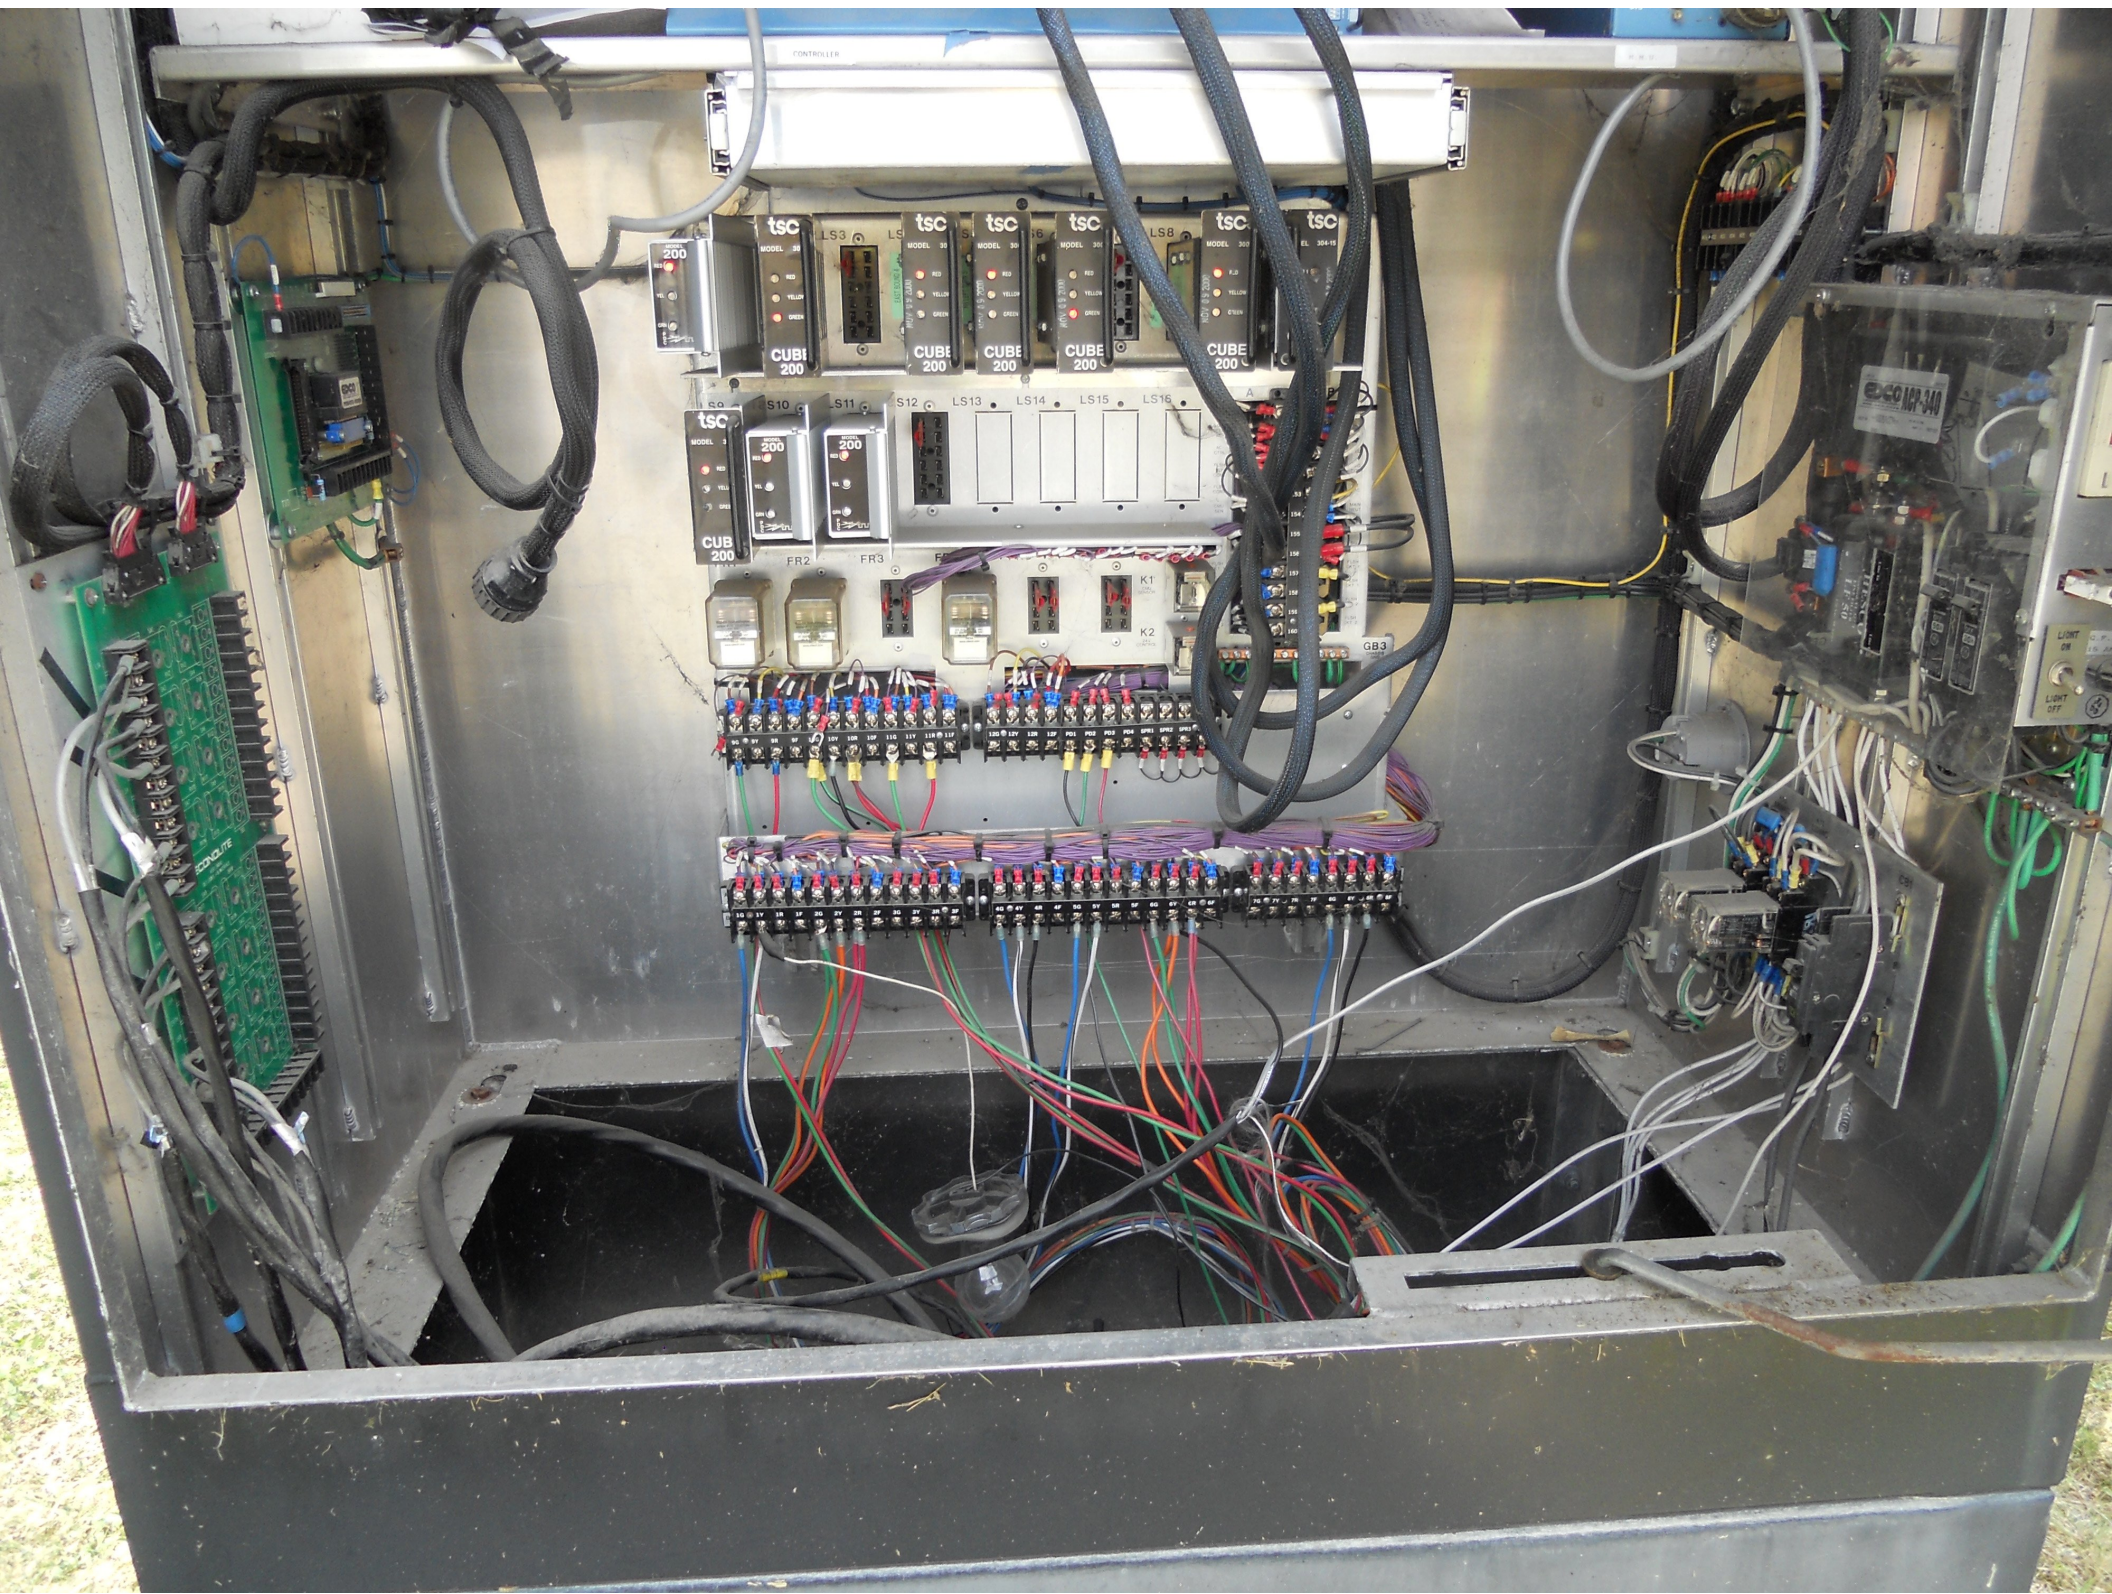
WARNING

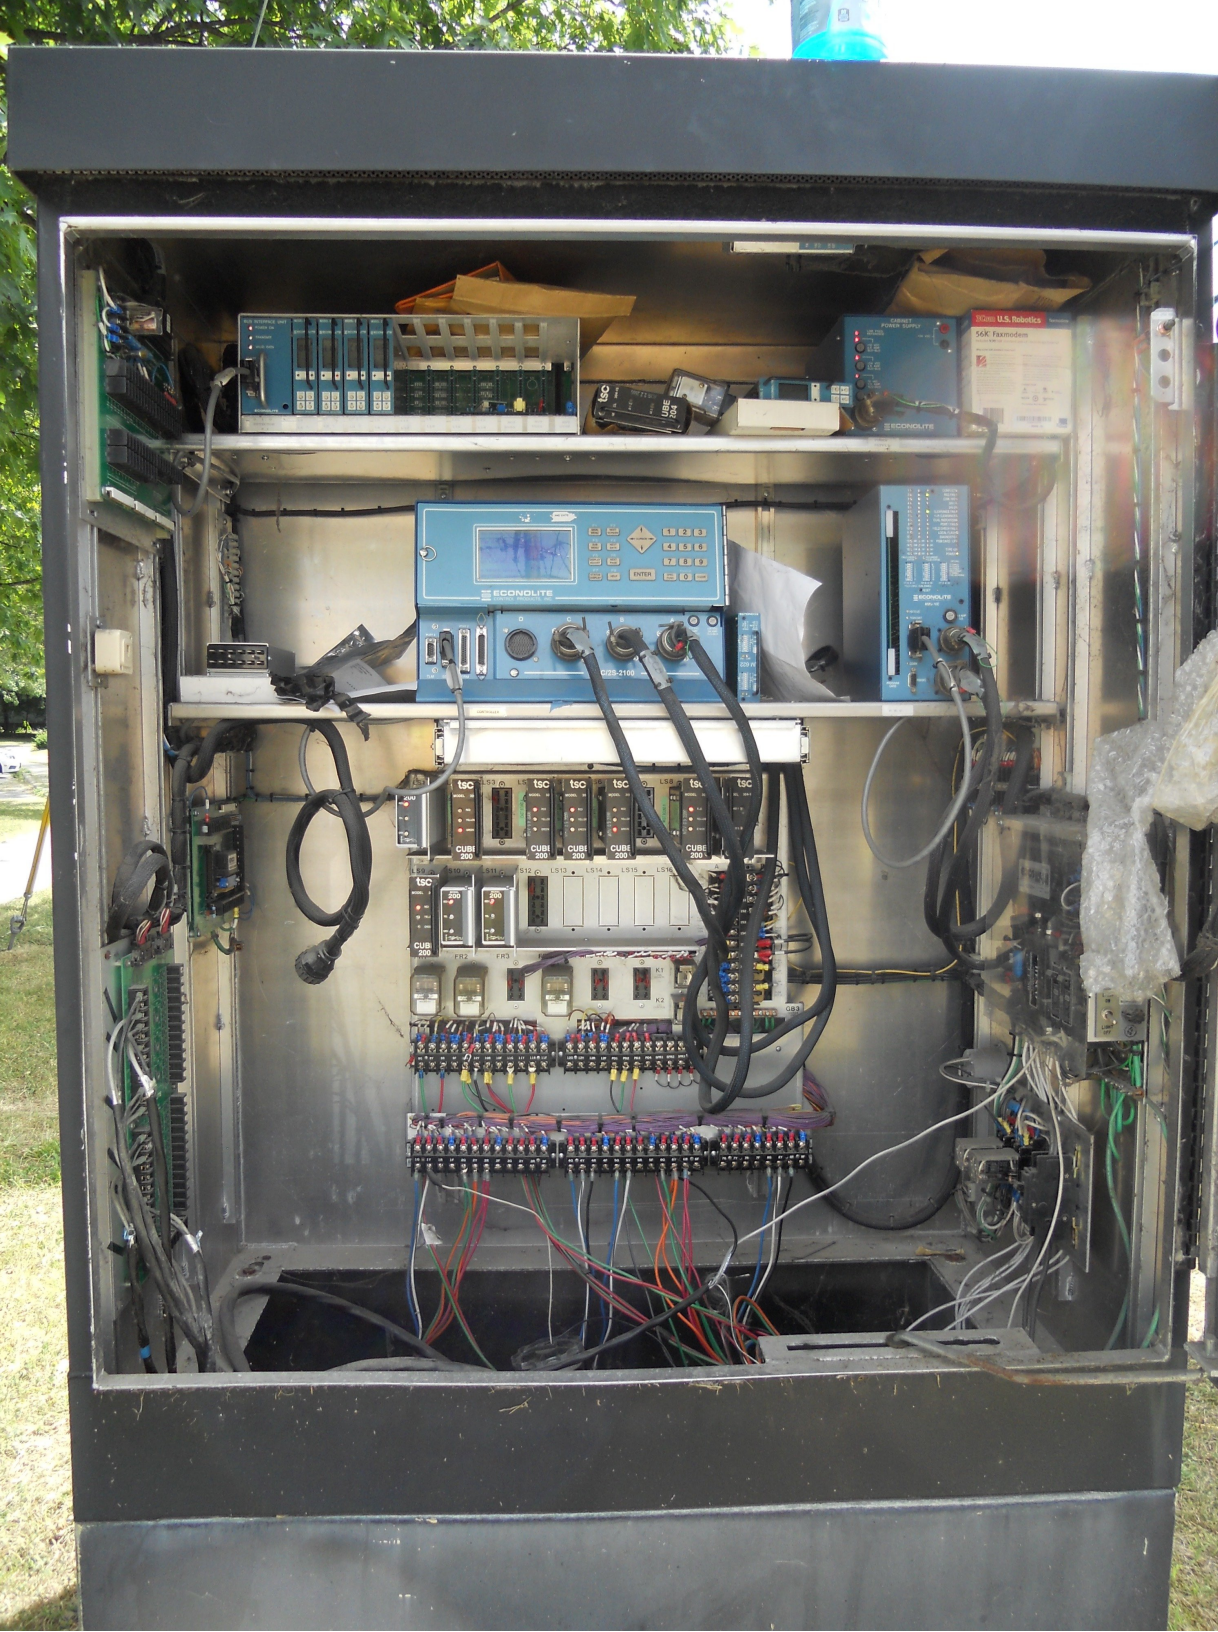
DO NOT OPERATE
CABINET WITHOUT
CMU / MMU



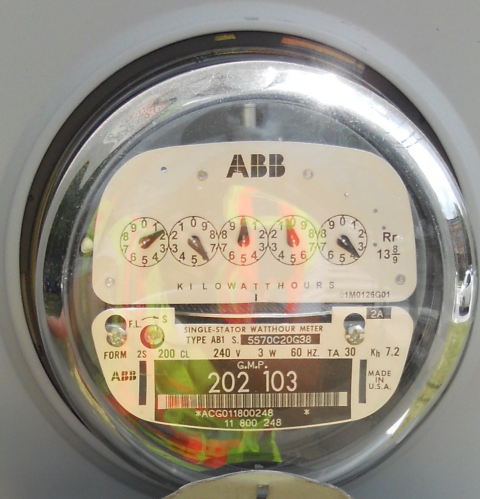








⚡ DANGER
HAZARD OF ELECTRICAL SHOCK
OR BURN IF COVER REMOVED.
SERVICE BY UTILITY
AUTHORIZED PERSONNEL ONLY.
DO NOT PAINT OVER OR REMOVE THIS LABEL.
TYPED NO. 802-1



⚡ DANGER
HAZARD OF ELECTRICAL SHOCK
OR BURN IF COVER REMOVED.
SERVICE BY UTILITY
AUTHORIZED PERSONNEL ONLY.
DO NOT PAINT OVER OR REMOVE THIS LABEL.







LEFT TURN
YIELD
ON GREEN

















Roger Arel

Car Sales Service & Parts Repair & More Financing & Maintenance & Repairs

Shelburne, VT

(802) 985-2045







Harbor Rd

BUS
STOP











SHIPLEY AVE

P

Harbor Rd

GREEMEE'S
ICE CREAM
MILKSHAKES





LEFT TURN
YIELD
ON GREEN













Falls Rd









Falls Rd



WALKING
DANBY
JULY 1

Coordination Patterns

.....

[illegible][illegible]

NIC Program Steps

Step	Program	Step Begins	Pattern	Override
------	---------	-------------	---------	----------

TOD Program Steps

Step 1 Program 1 Step Begins 0600

Flash.	Dimming Enable.
Red Rest	Alt Veh Extension
Spare 5.	Det Log Enable.
Spare 3.	Spare 4
Type 0 Dly Enable. . .	Spare 2
Det Diag Plan. . . . 0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	X	X	.	X	X	X	.	X	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

Step 2 Program 1 Step Begins 0900

Flash.	Dimming Enable.
Red Rest	Alt Veh Extension
Spare 5.	Det Log Enable.
Spare 3.	Spare 4
Type 0 Dly Enable. . .	Spare 2
Det Diag Plan. . . . 0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

TOD Program Steps

Step 3 Program 1 Step Begins 1500

Flash.	.	Dimming Enable.	.
Red Rest	.	Alt Veh Extension	.
Spare 5.	.	Det Log Enable.	.
Spare 3.	.	Spare 4	.
Type 0 Dly Enable. . .	.	Spare 2	.
Det Diag Plan.	0		

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	X	X	.	X	X	X	.	X	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

Step 4 Program 1 Step Begins 1800

Flash.	.	Dimming Enable.	.
Red Rest	.	Alt Veh Extension	.
Spare 5.	.	Det Log Enable.	.
Spare 3.	.	Spare 4	.
Type 0 Dly Enable. . .	.	Spare 2	.
Det Diag Plan.	0		

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

TOD Program Steps

Step 5 Program 1 Step Begins 2200

Flash.	X	Dimming Enable.
Red Rest	.	Alt Veh Extension
Spare 5.	.	Det Log Enable.
Spare 3.	.	Spare 4
Type 0 Dly Enable. . .	.	Spare 2
Det Diag Plan.	0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

Step 6 Program 2 Step Begins 0600

Flash.	.	Dimming Enable.
Red Rest	.	Alt Veh Extension
Spare 5.	.	Det Log Enable.
Spare 3.	.	Spare 4
Type 0 Dly Enable. . .	.	Spare 2
Det Diag Plan.	0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

TOD Program Steps

Step 7 Program 2 Step Begins 2100

Flash.	X	Dimming Enable.
Red Rest	.	Alt Veh Extension
Spare 5.	.	Det Log Enable.
Spare 3.	.	Spare 4
Type 0 Dly Enable. . .	.	Spare 2
Det Diag Plan.	0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

Step 9 Program 1 Step Begins 0820

Flash.	.	Dimming Enable.
Red Rest	.	Alt Veh Extension
Spare 5.	.	Det Log Enable.
Spare 3.	.	Spare 4
Type 0 Dly Enable. . .	.	Spare 2
Det Diag Plan.	0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	X	X	.	X	X	X	.	X	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

TOD Program Steps

Step 10 Program 1 Step Begins 1440

Flash.	Dimming Enable.
Red Rest	Alt Veh Extension
Spare 5.	Det Log Enable.
Spare 3.	Spare 4
Type 0 Dly Enable. . .	Spare 2
Det Diag Plan. . . . 0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	X	X	.	X	X	X	.	X	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

Step 11 Program 1 Step Begins 1510

Flash.	Dimming Enable.
Red Rest	Alt Veh Extension
Spare 5.	Det Log Enable.
Spare 3.	Spare 4
Type 0 Dly Enable. . .	Spare 2
Det Diag Plan. . . . 0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	X	X	.	X	X	X	.	X	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.