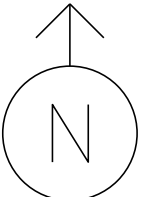


MS # 521



- ⊙ PEDESTAL POST
- Ⓟ PEDESTRIAN SIGNAL
- ⊠ CONTROL BOX
- ≡ COORDINATION
- - - LOOP DETECTION
- ⌞ LUMINAIRE
- ROADWAY SIGN

- Ⓐ =
- ⓕ =
- Ⓟ =
- Ⓢ =

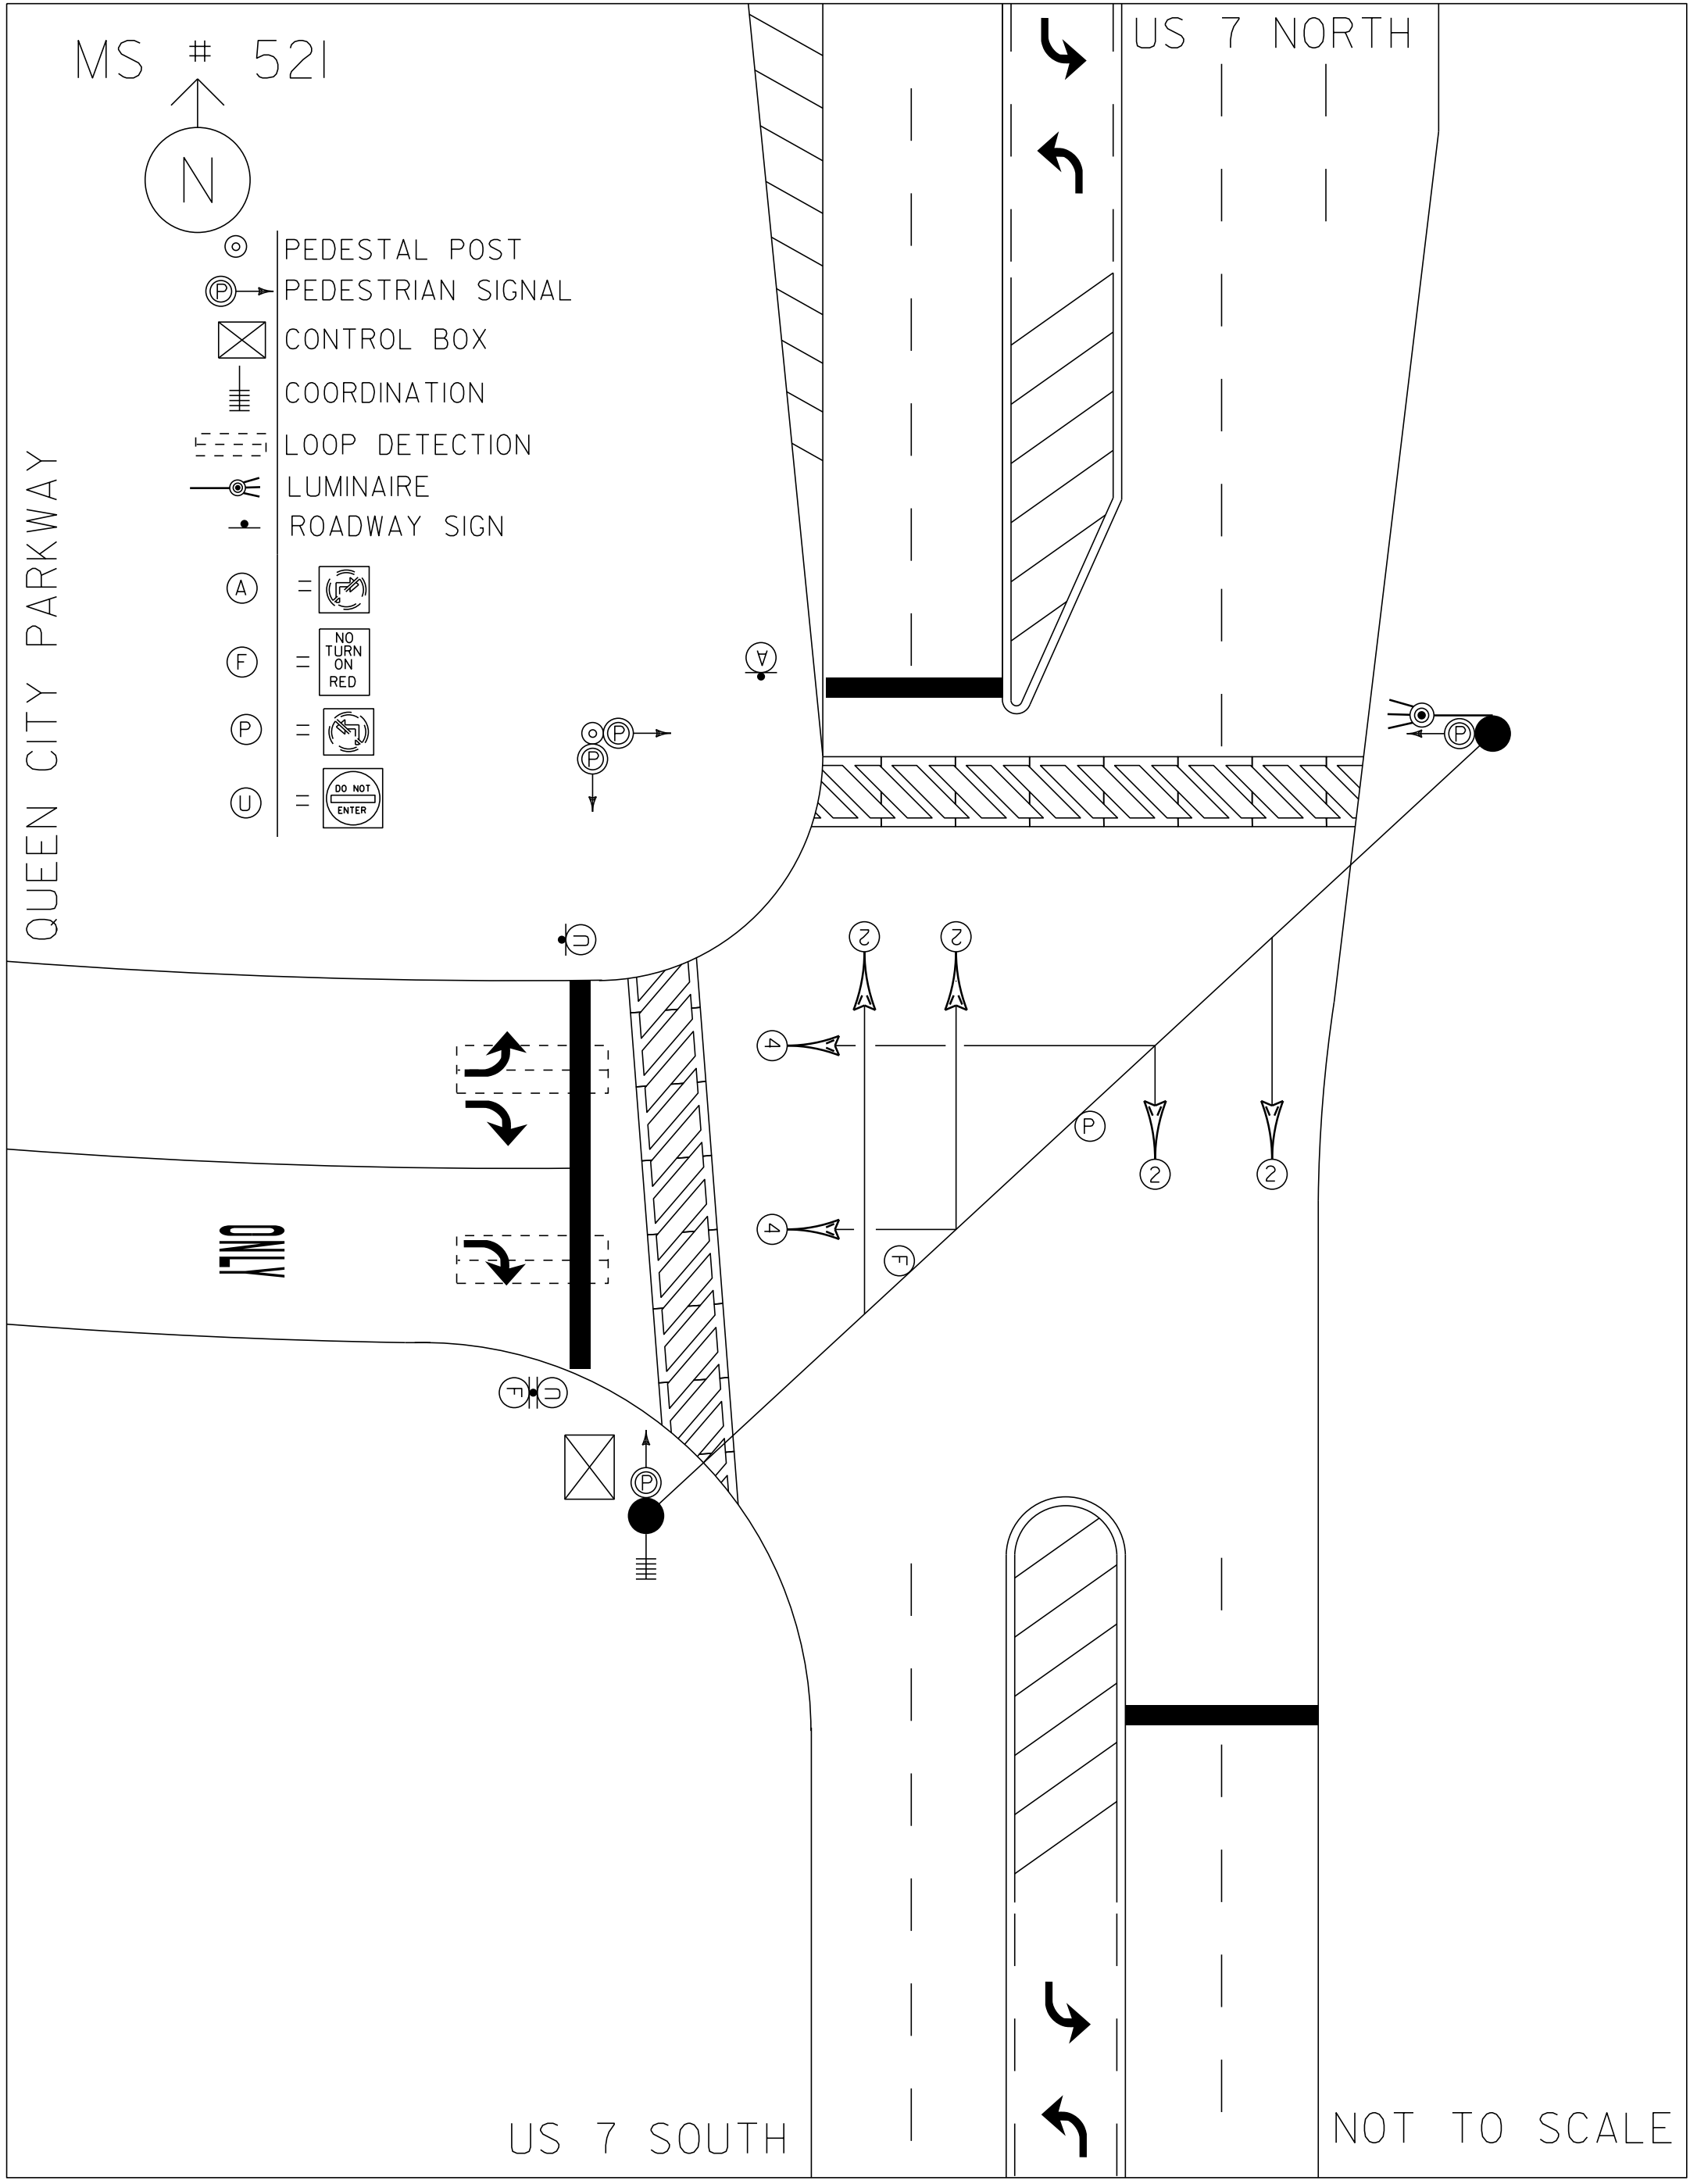
QUEEN CITY PARKWAY

US 7 NORTH

US 7 SOUTH

NOT TO SCALE

ONLY



MS # 521

N

QUEEN CITY PARKWAY

US 7 NORTH

11' 12'

12'

STOP BAR 22'

CROSSWALK 66'

STOP BAR 35'

LANE LINE 90'

CROSSWALK 50'

ONLY

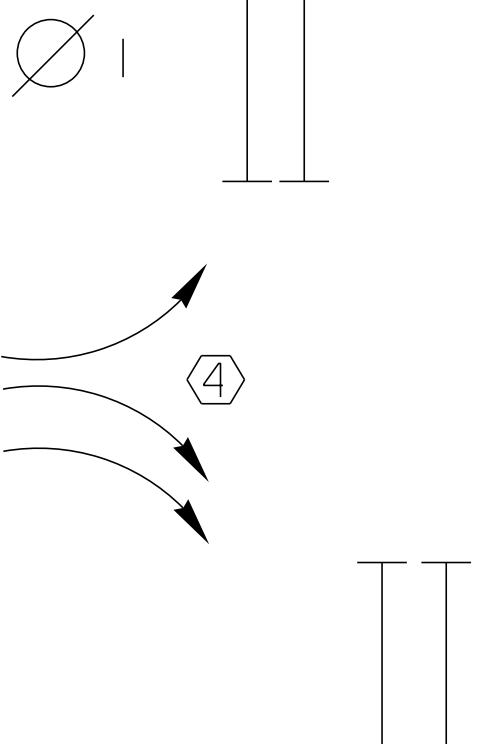
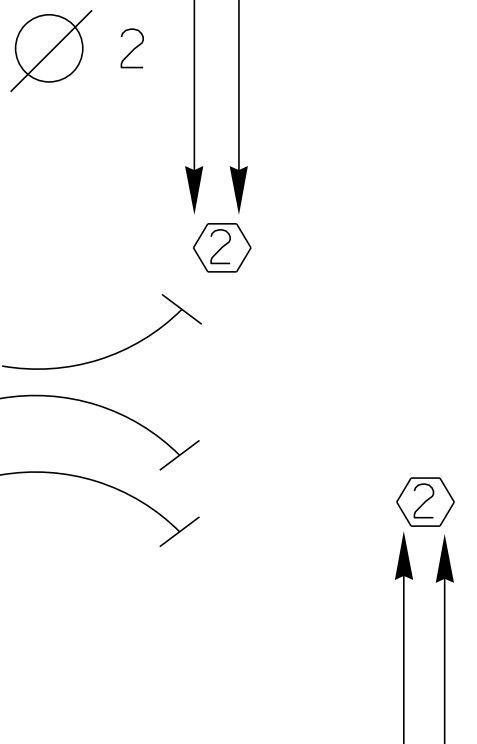
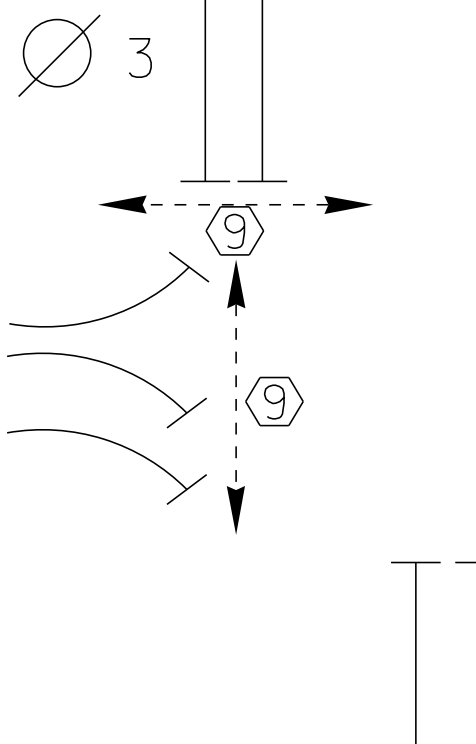
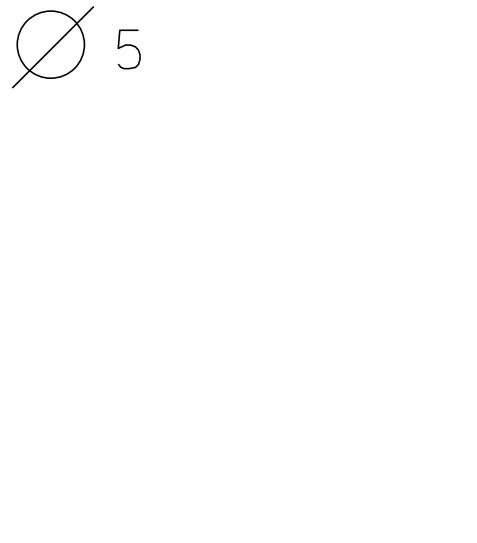
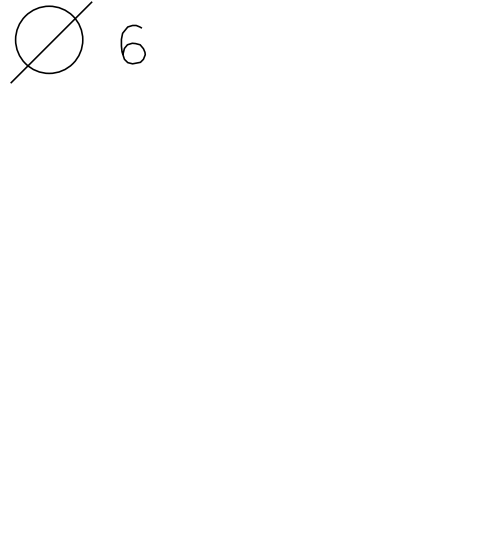
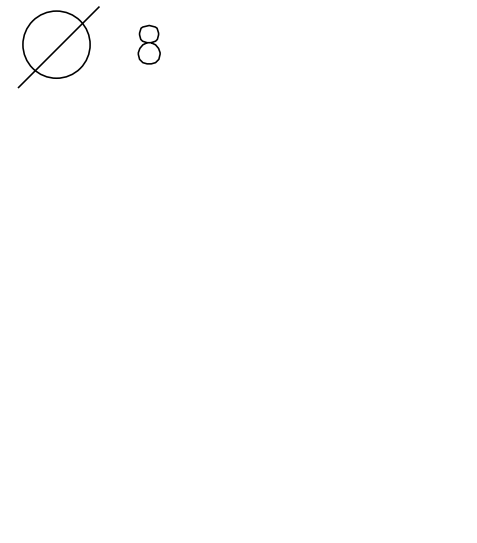
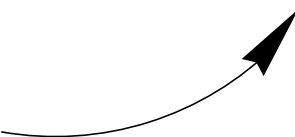
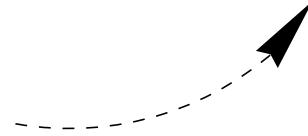
STOP BAR 23'

11' 11'

11' 12'

US 7 SOUTH

NOT TO SCALE

D I A G R A M				
TIMING	G = Y =	G = Y =	G = Y =	G = Y =
D I A G R A M				
TIMING	G = Y =	G = Y =	G = Y =	G = Y =
 PROTECTED TURNS	 PERMITTED TURNS  PEDESTRIAN		CYCLE LENGTH, C= _____ S	

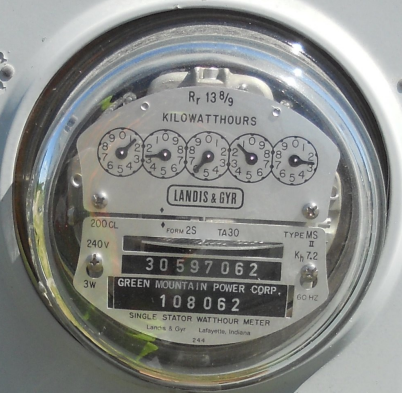


PROPERTY OF
VT. AGENCY OF TRANS.
MAINTENANCE DIV.
IN EMERGENCY CALL
DOT TRASH SERVICE
855-5885
NIGHTS & WEEKENDS 878-777

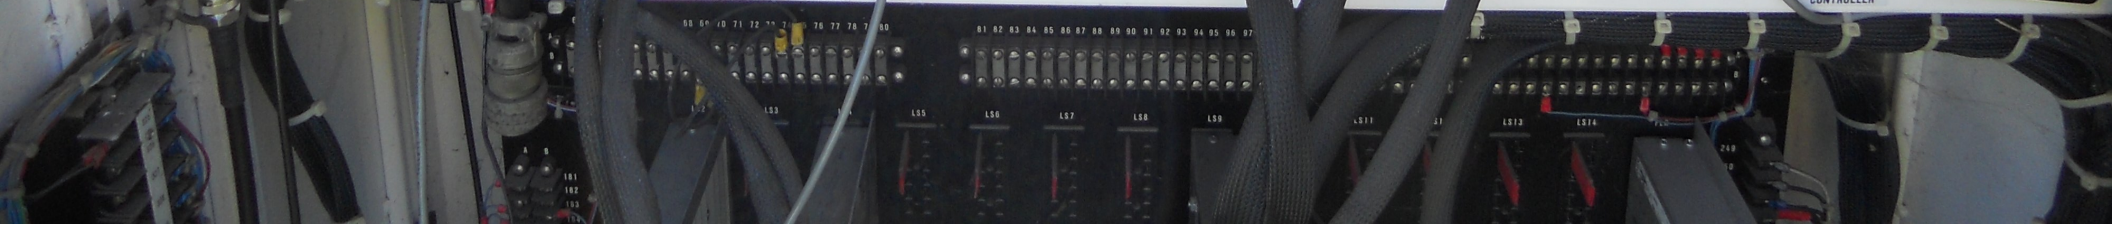
PROPERTY OF:
VT. AGENCY OF TRANS.
MAINTENANCE DIV.

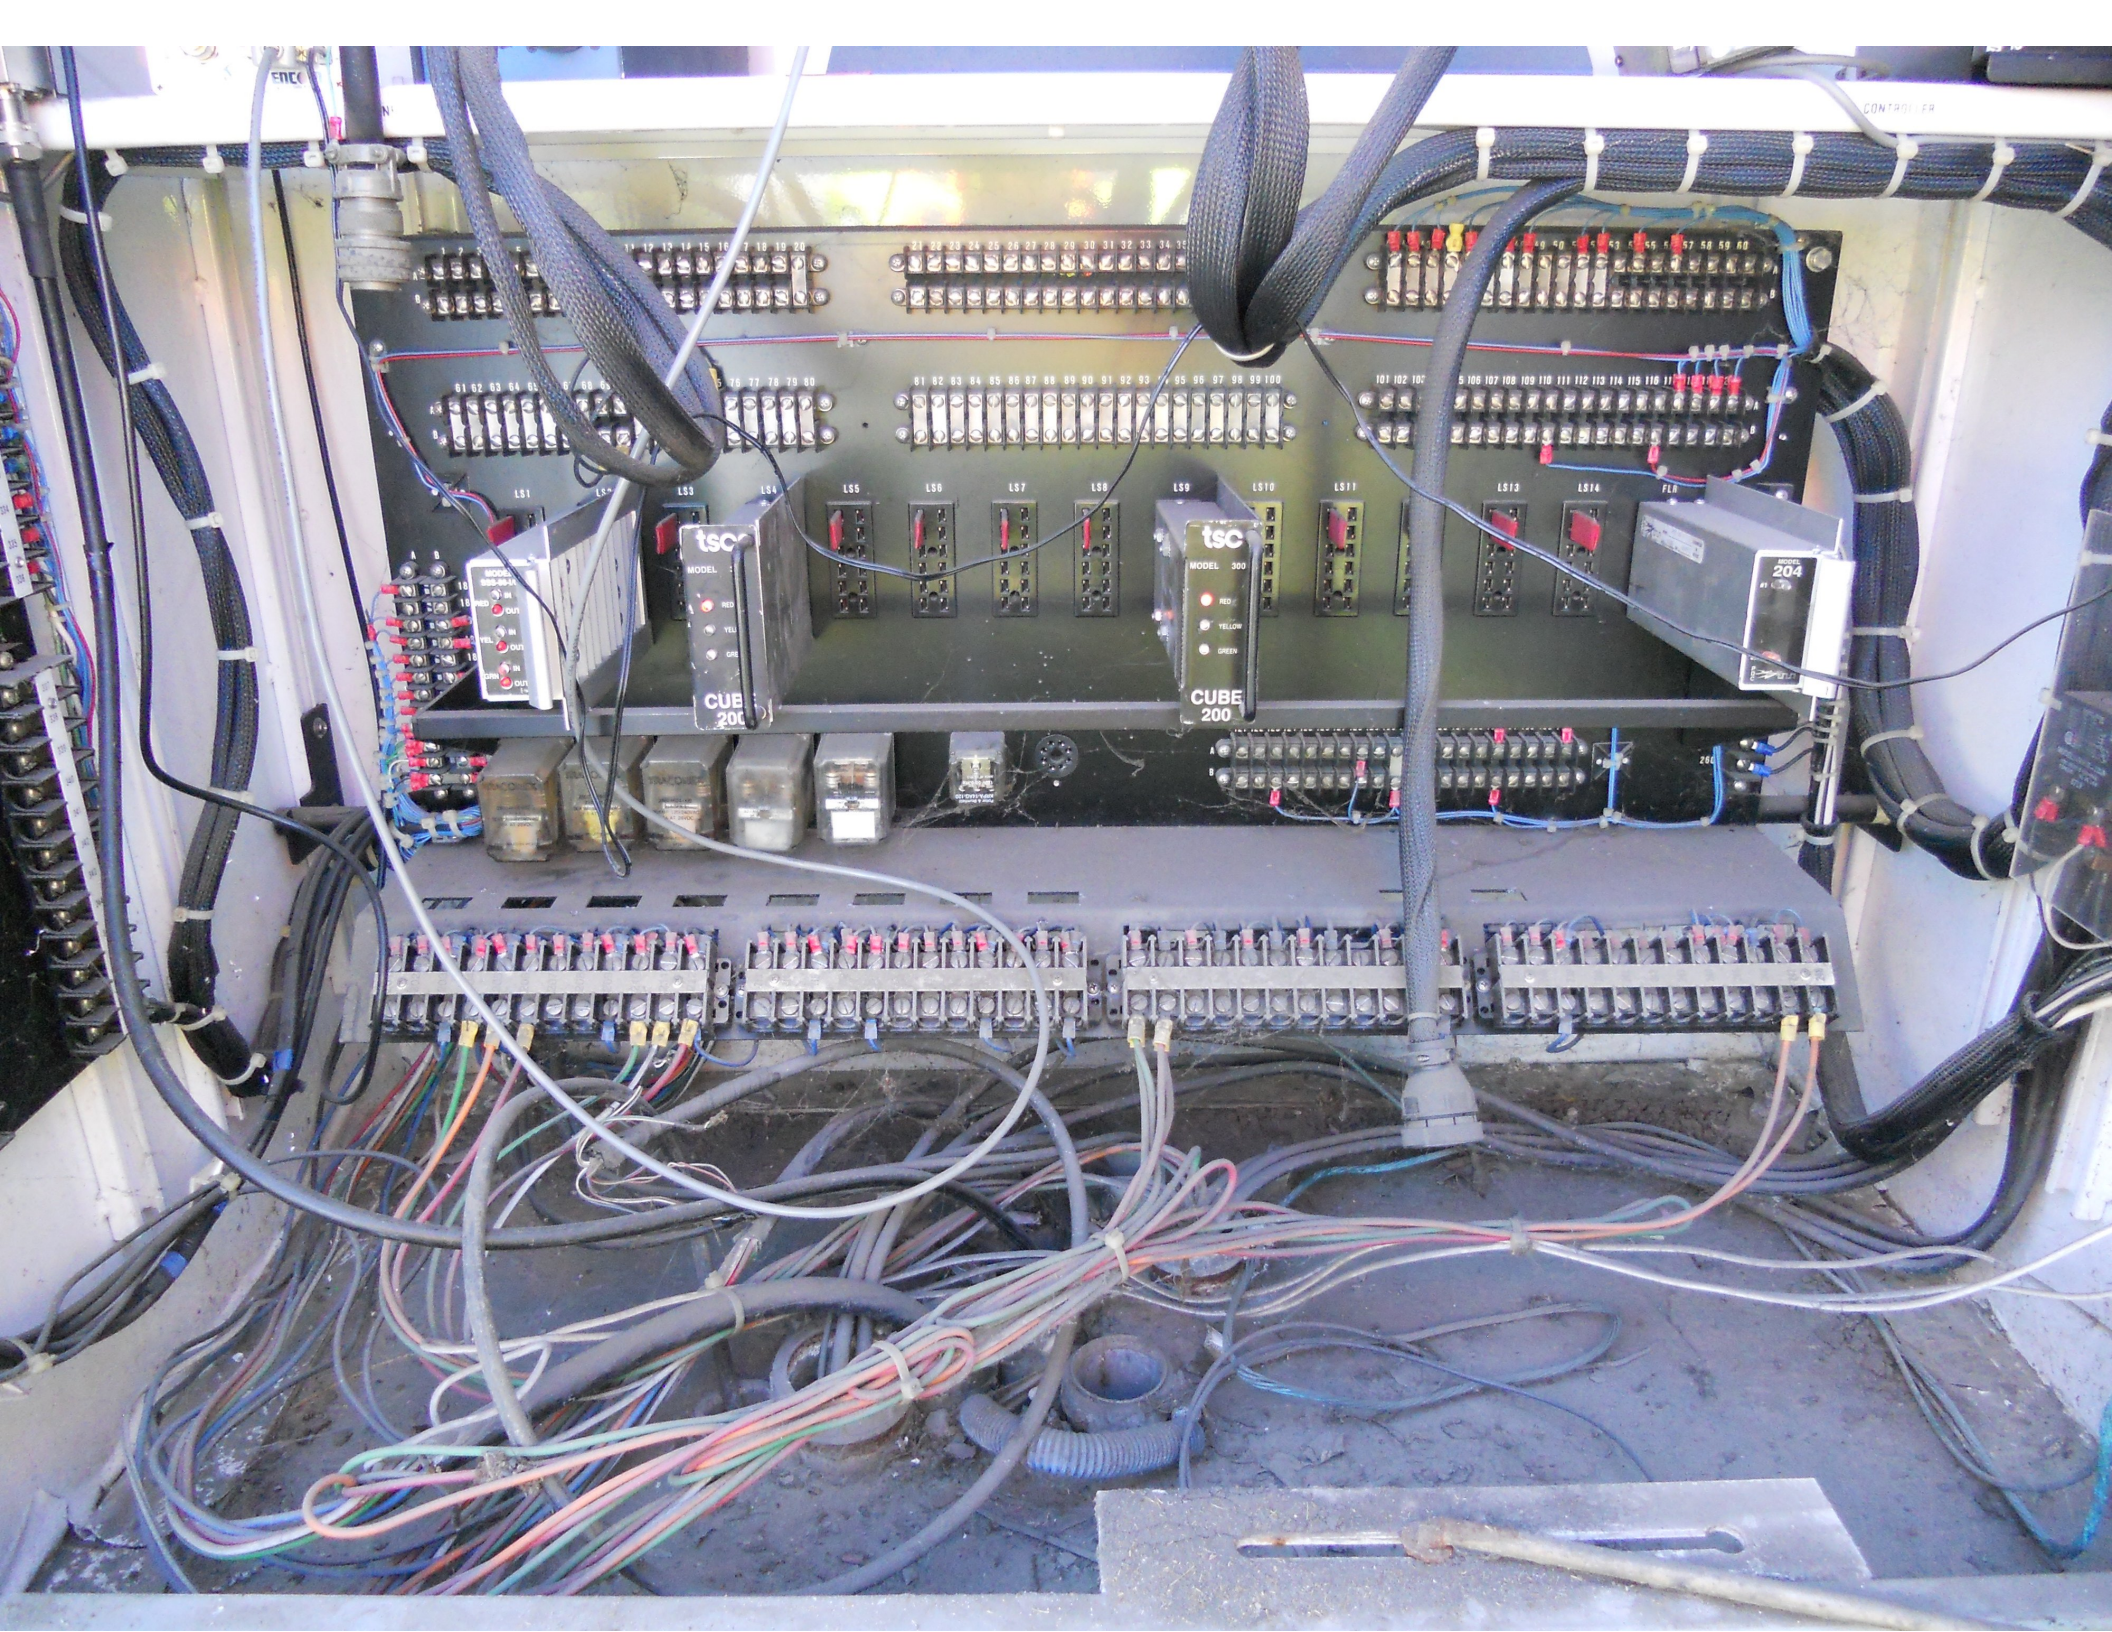
IN EMERGENCY CALL:
DIST. TRANS. OFFICE
655-1580

NIGHTS & WEEKENDS: 878-7111



















POLE #7-3
150W - H.P.S.







SIGNAL
SET FOR
30
MPH

357

NO RIGHT TURN























POLE #7-4
150W - H.P.S.







NO
TURN
ON RED

KOTO



NO
TURN
ON RED

KOTO









Coordination Patterns

Pattern 1

Cycle Length . . . 98 COS 111

Offset 12

Vehicle Permissive . . [1] 0 [2] 0

Vehicle Perm 2 Displacement 0 Phase Reservice. . NO

Splits: Phase 1- 0 2- 70 3- 1 4- 28

Phase 5- 0 6- 70 7- 0 8- 0

Phase 9- 0 10- 0 11- 0 12- 0 Split Sum: 0

Split Extension/Ring [1] 0 [2] 0

Split Demand Pattern [1] 0 [2] 0

XRT Pattern. . . 0

Phase Number: 1 2 3 4 5 6 7 8 9 10 11 12

Coord Phases . . . X . . . X

Veh Recall

Veh Max Recall

Ped Recall

Veh Omit

Alt Sequence . . A: . B: . C: . D: . E: . F: .

Pattern 2

Cycle Length . . . 96 COS 211

Offset 92

Vehicle Permissive . . [1] 0 [2] 0

Vehicle Perm 2 Displacement 0 Phase Reservice. . NO

Splits: Phase 1- 0 2- 79 3- 1 4- 17

Phase 5- 0 6- 79 7- 0 8- 0

Phase 9- 0 10- 0 11- 0 12- 0 Split Sum: 0

Split Extension/Ring [1] 0 [2] 0

Split Demand Pattern [1] 0 [2] 0

XRT Pattern. . . 0

Phase Number: 1 2 3 4 5 6 7 8 9 10 11 12

Coord Phases . . . X . . . X

Veh Recall

Veh Max Recall

Ped Recall

Veh Omit

Alt Sequence . . A: . B: . C: . D: . E: . F: .

Pattern 3

Cycle Length . . . 106 COS 311

Offset 8

Vehicle Permissive . . [1] 0 [2] 0

Vehicle Perm 2 Displacement 0 Phase Reservice. . NO

Splits: Phase 1- 0 2- 78 3- 1 4- 28

Phase 5- 0 6- 78 7- 0 8- 0

Phase 9- 0 10- 0 11- 0 12- 0 Split Sum: 0

Split Extension/Ring [1] 0 [2] 0

Split Demand Pattern [1] 0 [2] 0

XRT Pattern. . . 0

Phase Number: 1 2 3 4 5 6 7 8 9 10 11 12

Coord Phases . . . X . . . X

Veh Recall

Veh Max Recall

Ped Recall

Veh Omit

Alt Sequence . . A: . B: . C: . D: . E: . F: .

NIC Program Steps

Step	Program	Step Begins	Pattern	Override
1	1	0600	1	NO
2	1	0930	2	NO
3	1	1430	3	NO
4	1	1900	2	NO
5	1	0000	0	NO
6	2	0600	2	NO
7	2	0000	0	NO

TOD Program Steps

Step 1 Program 1 Step Begins 0600

Flash.	Dimming Enable.
Red Rest	Alt Veh Extension
Spare 5.	Det Log Enable.
Spare 3.	Spare 4
Type 0 Dly Enable. . .	Spare 2
Det Diag Plan. . . . 0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

Step 2 Program 1 Step Begins 0930

Flash.	Dimming Enable.
Red Rest	Alt Veh Extension
Spare 5.	Det Log Enable.
Spare 3.	Spare 4
Type 0 Dly Enable. . .	Spare 2
Det Diag Plan. . . . 0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	X	X	X	X	X	X	X	X	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

TOD Program Steps

Step 3 Program 1 Step Begins 1430

Flash.	Dimming Enable.
Red Rest	Alt Veh Extension
Spare 5.	Det Log Enable.
Spare 3.	Spare 4
Type 0 Dly Enable. . .	Spare 2
Det Diag Plan. . . . 0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	X	X	X	X	X	X	X	X	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

Step 4 Program 1 Step Begins 1900

Flash.	Dimming Enable.
Red Rest	Alt Veh Extension
Spare 5.	Det Log Enable.
Spare 3.	Spare 4
Type 0 Dly Enable. . .	Spare 2
Det Diag Plan. . . . 0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	X	X	X	X	X	X	X	X	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

TOD Program Steps

Step 5 Program 1 Step Begins 0000

Flash.	X	Dimming Enable.
Red Rest	.	Alt Veh Extension
Spare 5.	.	Det Log Enable.
Spare 3.	.	Spare 4
Type 0 Dly Enable. . .	.	Spare 2
Det Diag Plan.	0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

Step 6 Program 2 Step Begins 0600

Flash.	.	Dimming Enable.
Red Rest	.	Alt Veh Extension
Spare 5.	.	Det Log Enable.
Spare 3.	.	Spare 4
Type 0 Dly Enable. . .	.	Spare 2
Det Diag Plan.	0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	X	X	X	X	X	X	X	X	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

TOD Program Steps

Step 7 Program 2 Step Begins 0000

Flash.	X	Dimming Enable.
Red Rest	.	Alt Veh Extension
Spare 5.	.	Det Log Enable.
Spare 3.	.	Spare 4
Type 0 Dly Enable. . .	.	Spare 2
Det Diag Plan. . . .	0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.
