


MS # 568

VT 2A NORTH

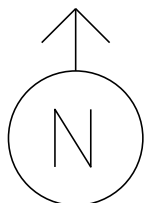


- | | |
|-----|-----------------------|
| | PEDESTAL POST |
| | PEDESTRIAN SIGNAL |
| | PREEMPTION DETECTOR |
| | PREEMPTION STROBE |
| | L.E.D REGULATORY SIGN |
| | CONTROL BOX |
| | MAST ARM |
| | LOOP DETECTION |
| | PULL BOX |
| | LUMINAIRE |
| | STANCHION |
| (A) | = |
| (B) | = |
| (C) | = |

US 2 WEST


US 2 EAST

VT 2A SOUTH

NOT TO SCALE

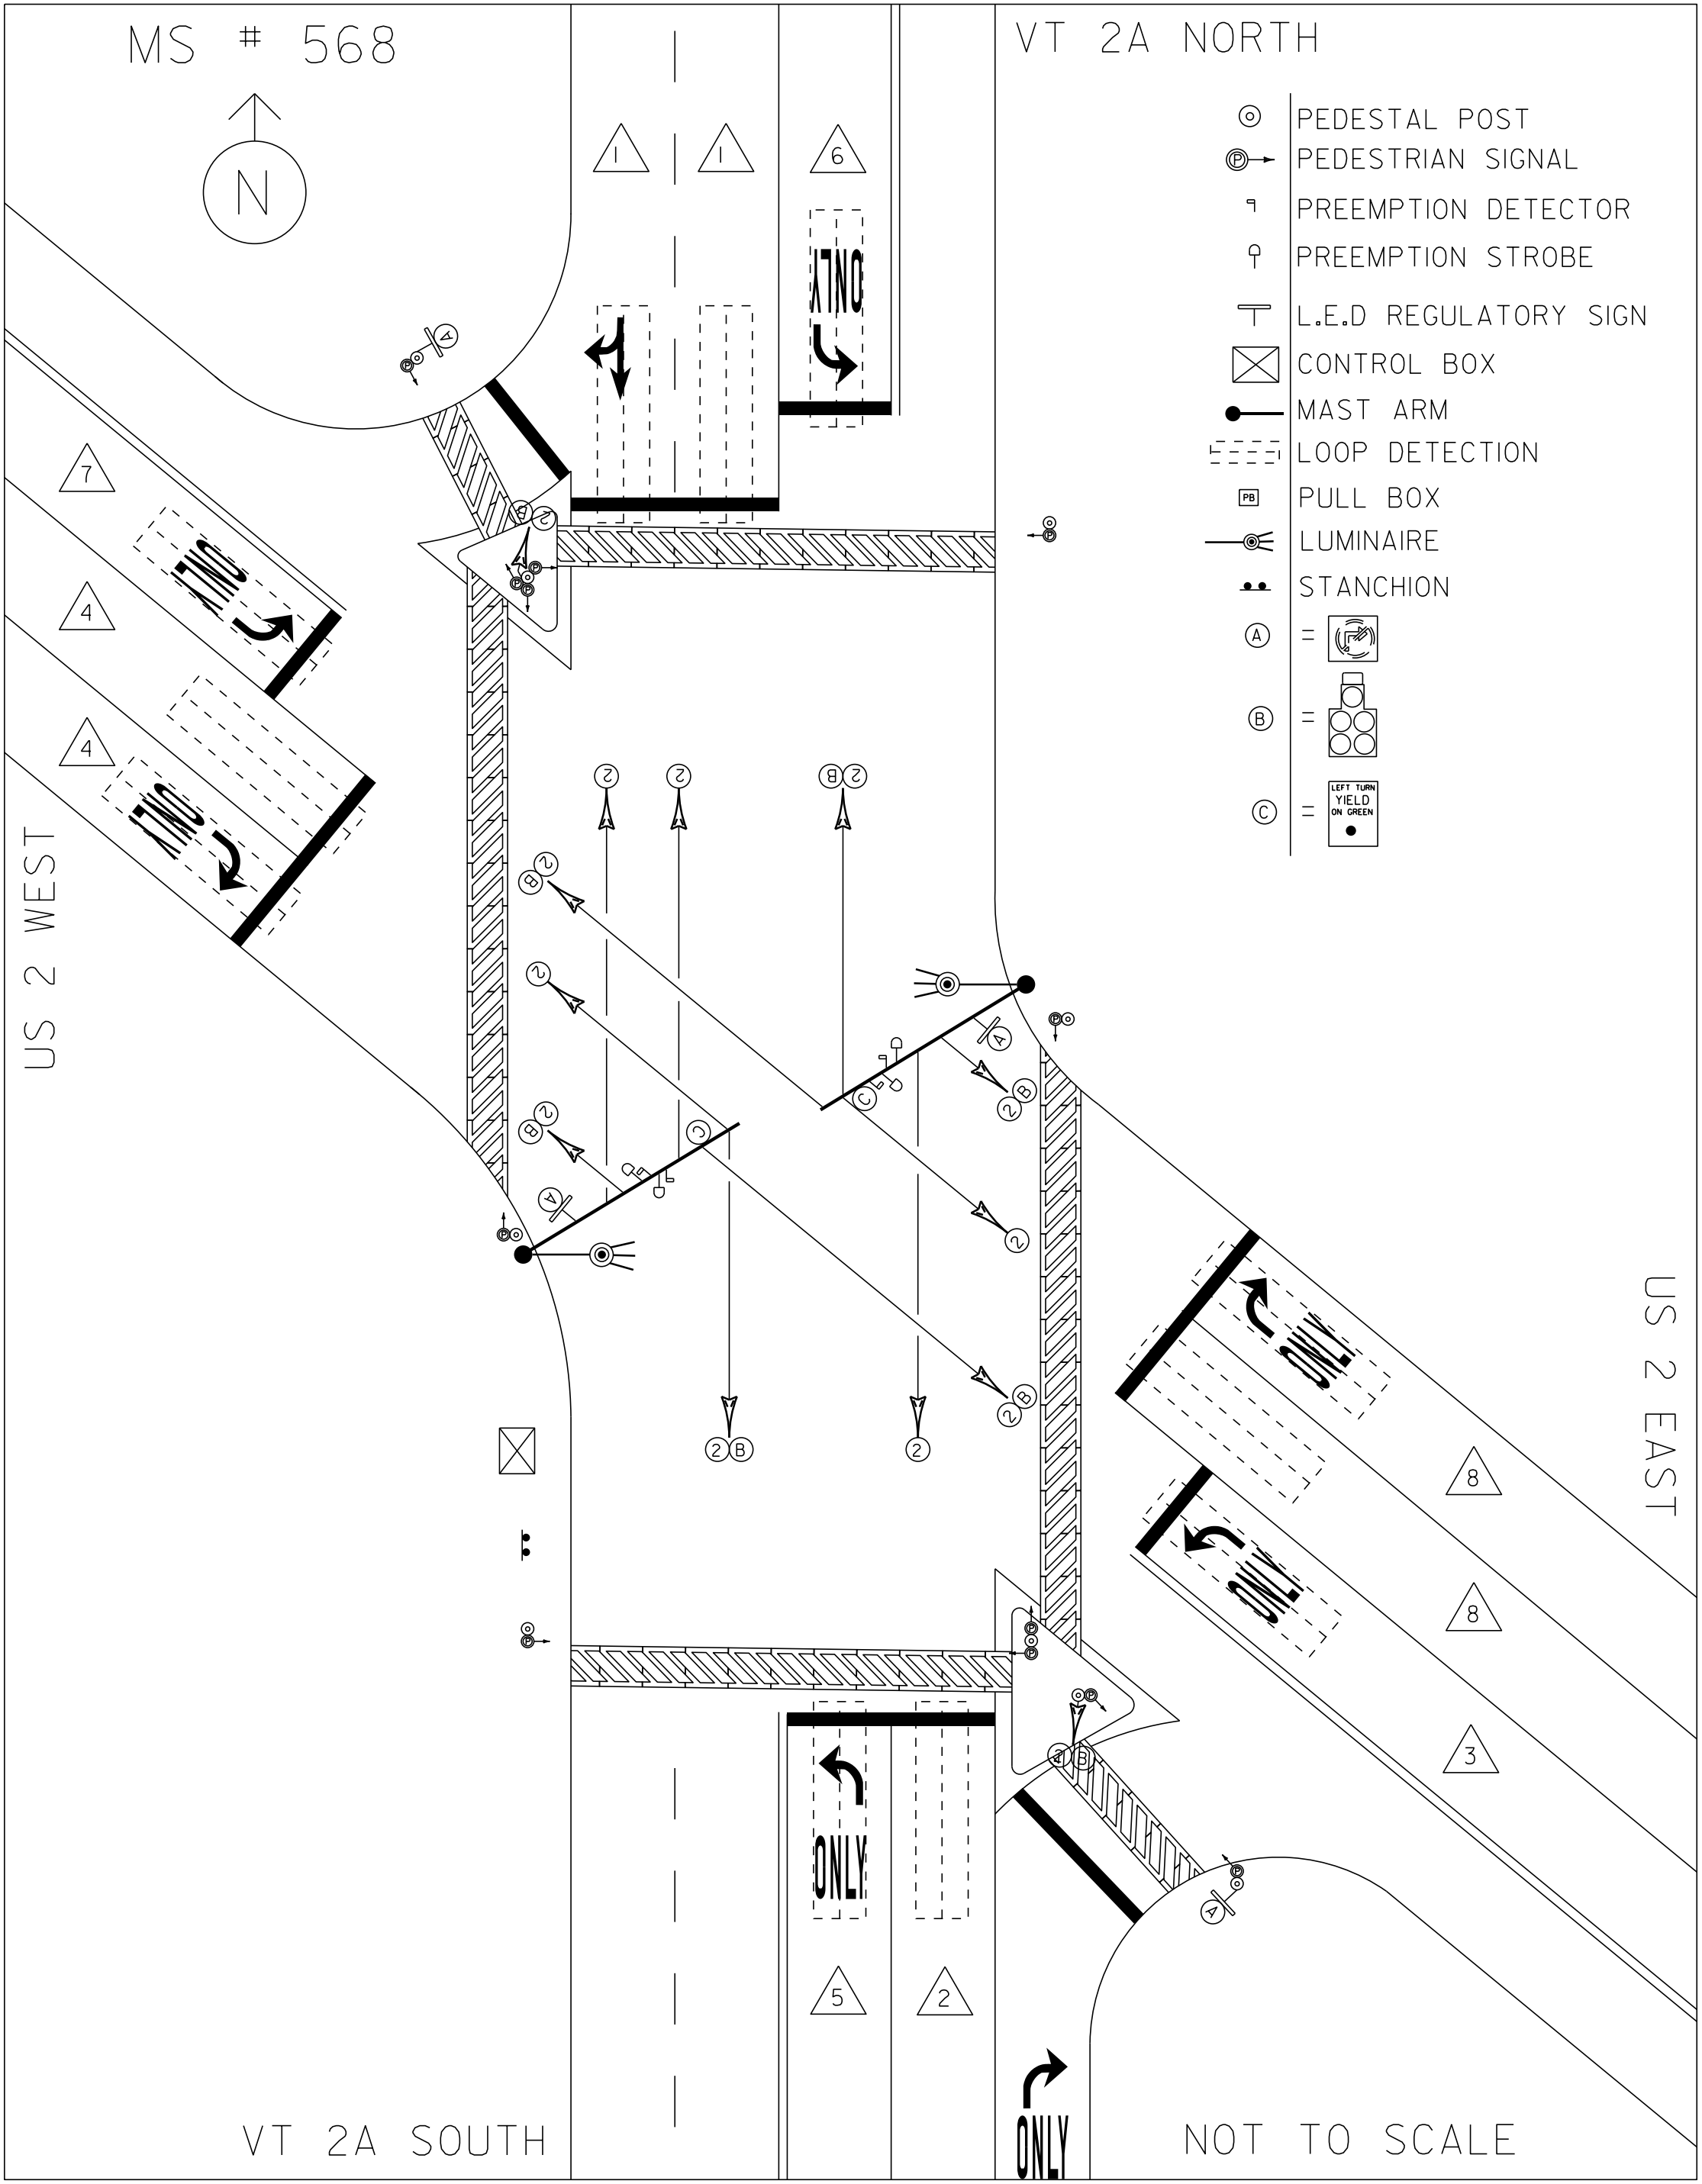

MS # 568

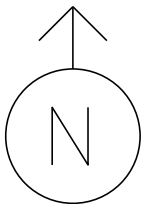

VT 2A NORTH

12'

STOP BAR 17'

LANE LINE 390'

ONLY

STOP BAR 21'

STOP BAR 11'

11'

11'

11'

US 2 WEST

LANE LINE 680'

11'

STOP BAR 11'

STOP BAR 22'

ONLY

ONLY

11'

11'

11'

11'

STOP BAR 24'

ONLY

LANE LINE 535'

LANE LINE 265'

12'

12'

12'

12'

ONLY

STOP BAR 26'

26'

STOP BAR 11'

STOP BAR 21'

ONLY

ONLY

LANE LINE 200'

LANE LINE 110'

US 2 EAST

11'









10'

11'

11'

VT 2A SOUTH

NOT TO SCALE

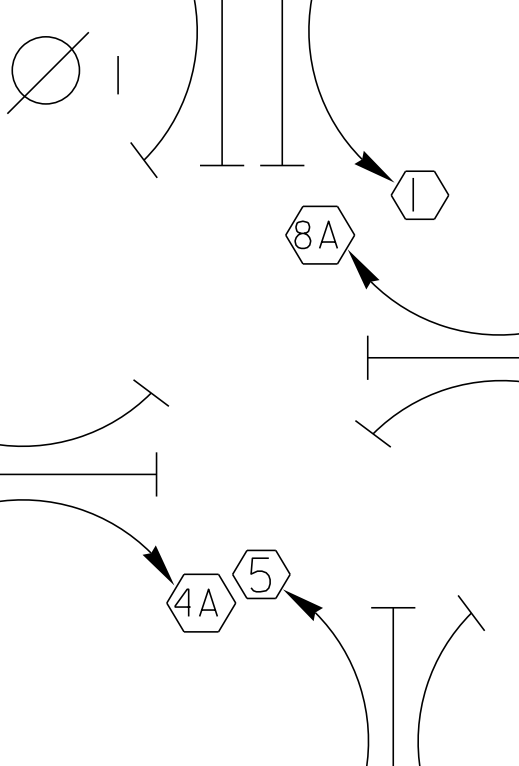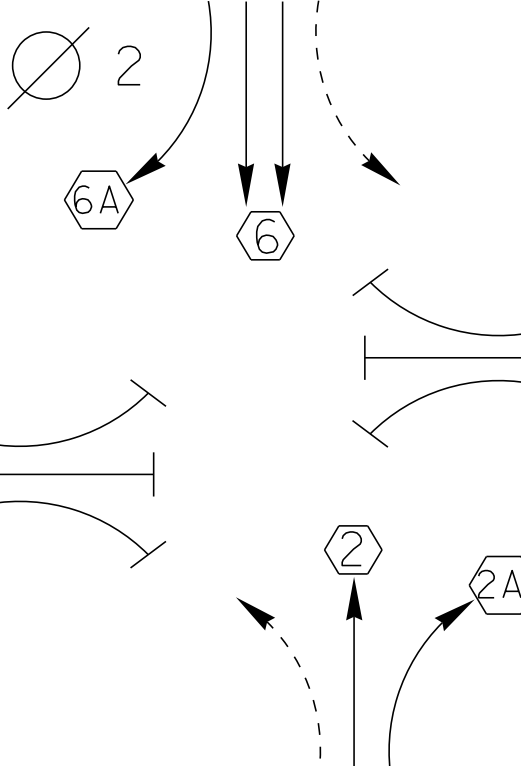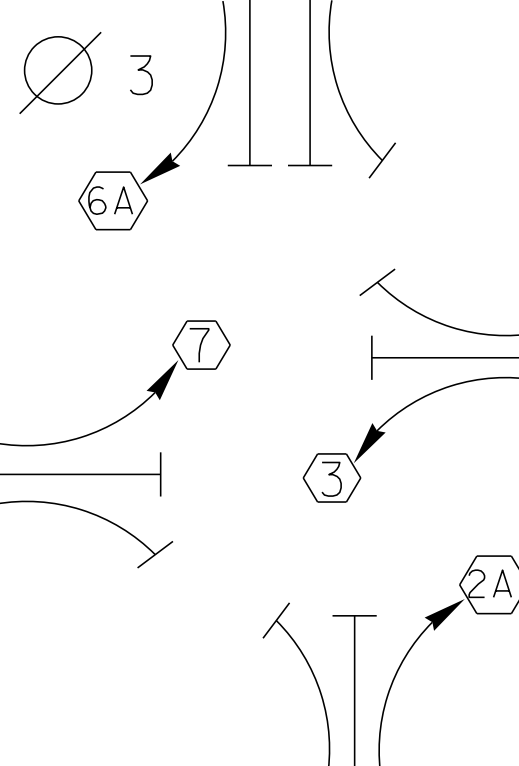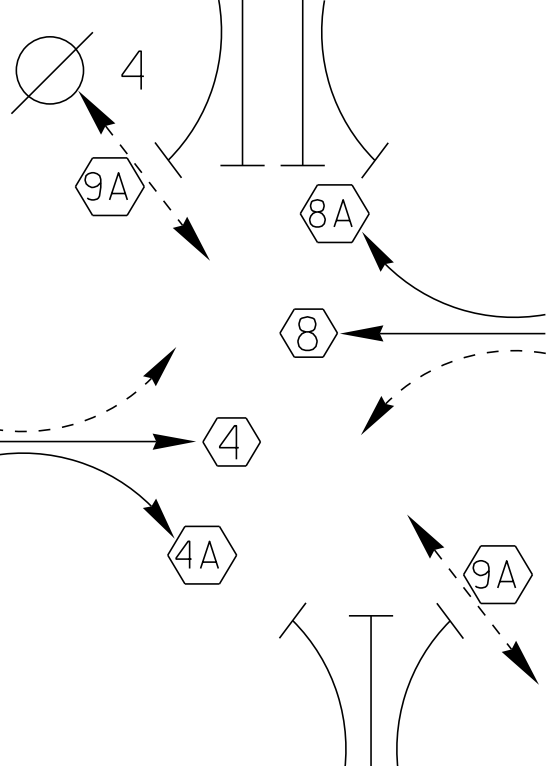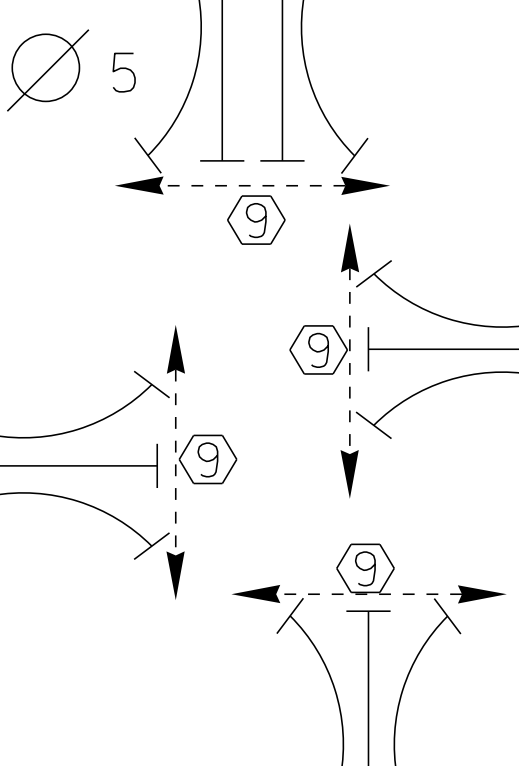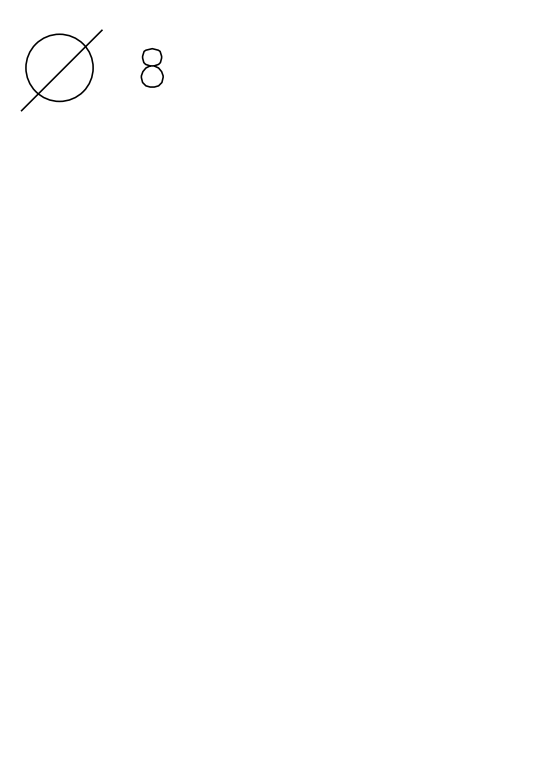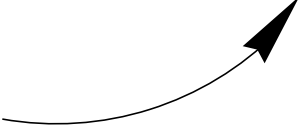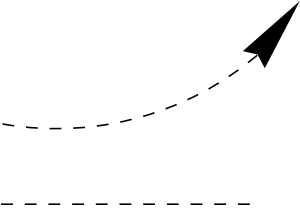D I A G R A M 				
TIMING	G = Y =	G = Y =	G = Y =	G = Y =
D I A G R A M				
TIMING	G = Y =	G = Y =	G = Y =	G = Y =
 PROTECTED TURNS	 PERMITTED TURNS PEDESTRIAN	CYCLE LENGTH, C= _____ S		



PROPERTY OF
VT. AGENCY OF TRANS.
MAINTENANCE DIV.

IN EMERGENCY CALL:
DIST. TRANS. OFFICE

NIGHT & WEEKENDS:

INTERSECTION NO.

WARNING

DO NOT OPERATE
CABINET WITHOUT
CONFLICT MONITOR UNIT

TURN ON 10-9-01

DANGER

115 VOLTS A.C.

TURN ON
10-9-01


CONTROLLER
ON
OFF

SIGNALS
AUTO
FLASH

MAN
ON
OFF

STOP TIME
AUTO
OFF
ON

ECONOMY

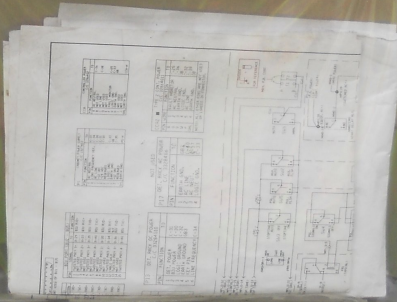

WARNING



DO NOT OPERATE
CABINET WITHOUT
CONFLICT MONITOR UNIT


TURN ON 10 9 01


DANG

115 VOLT

TURN ON
10-9-01

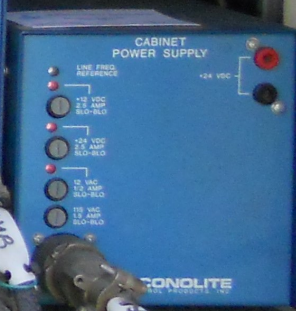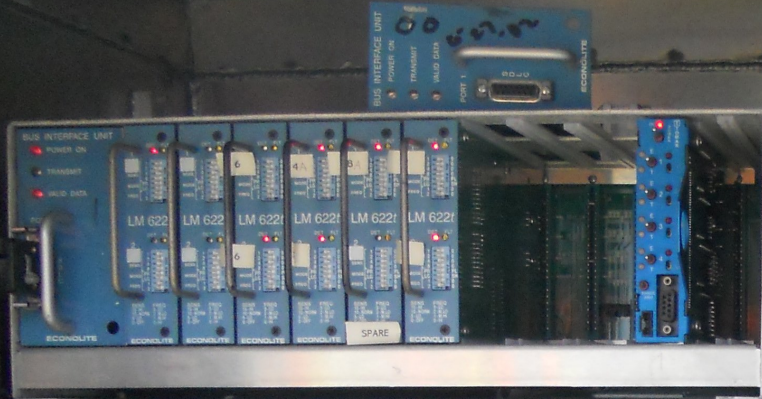

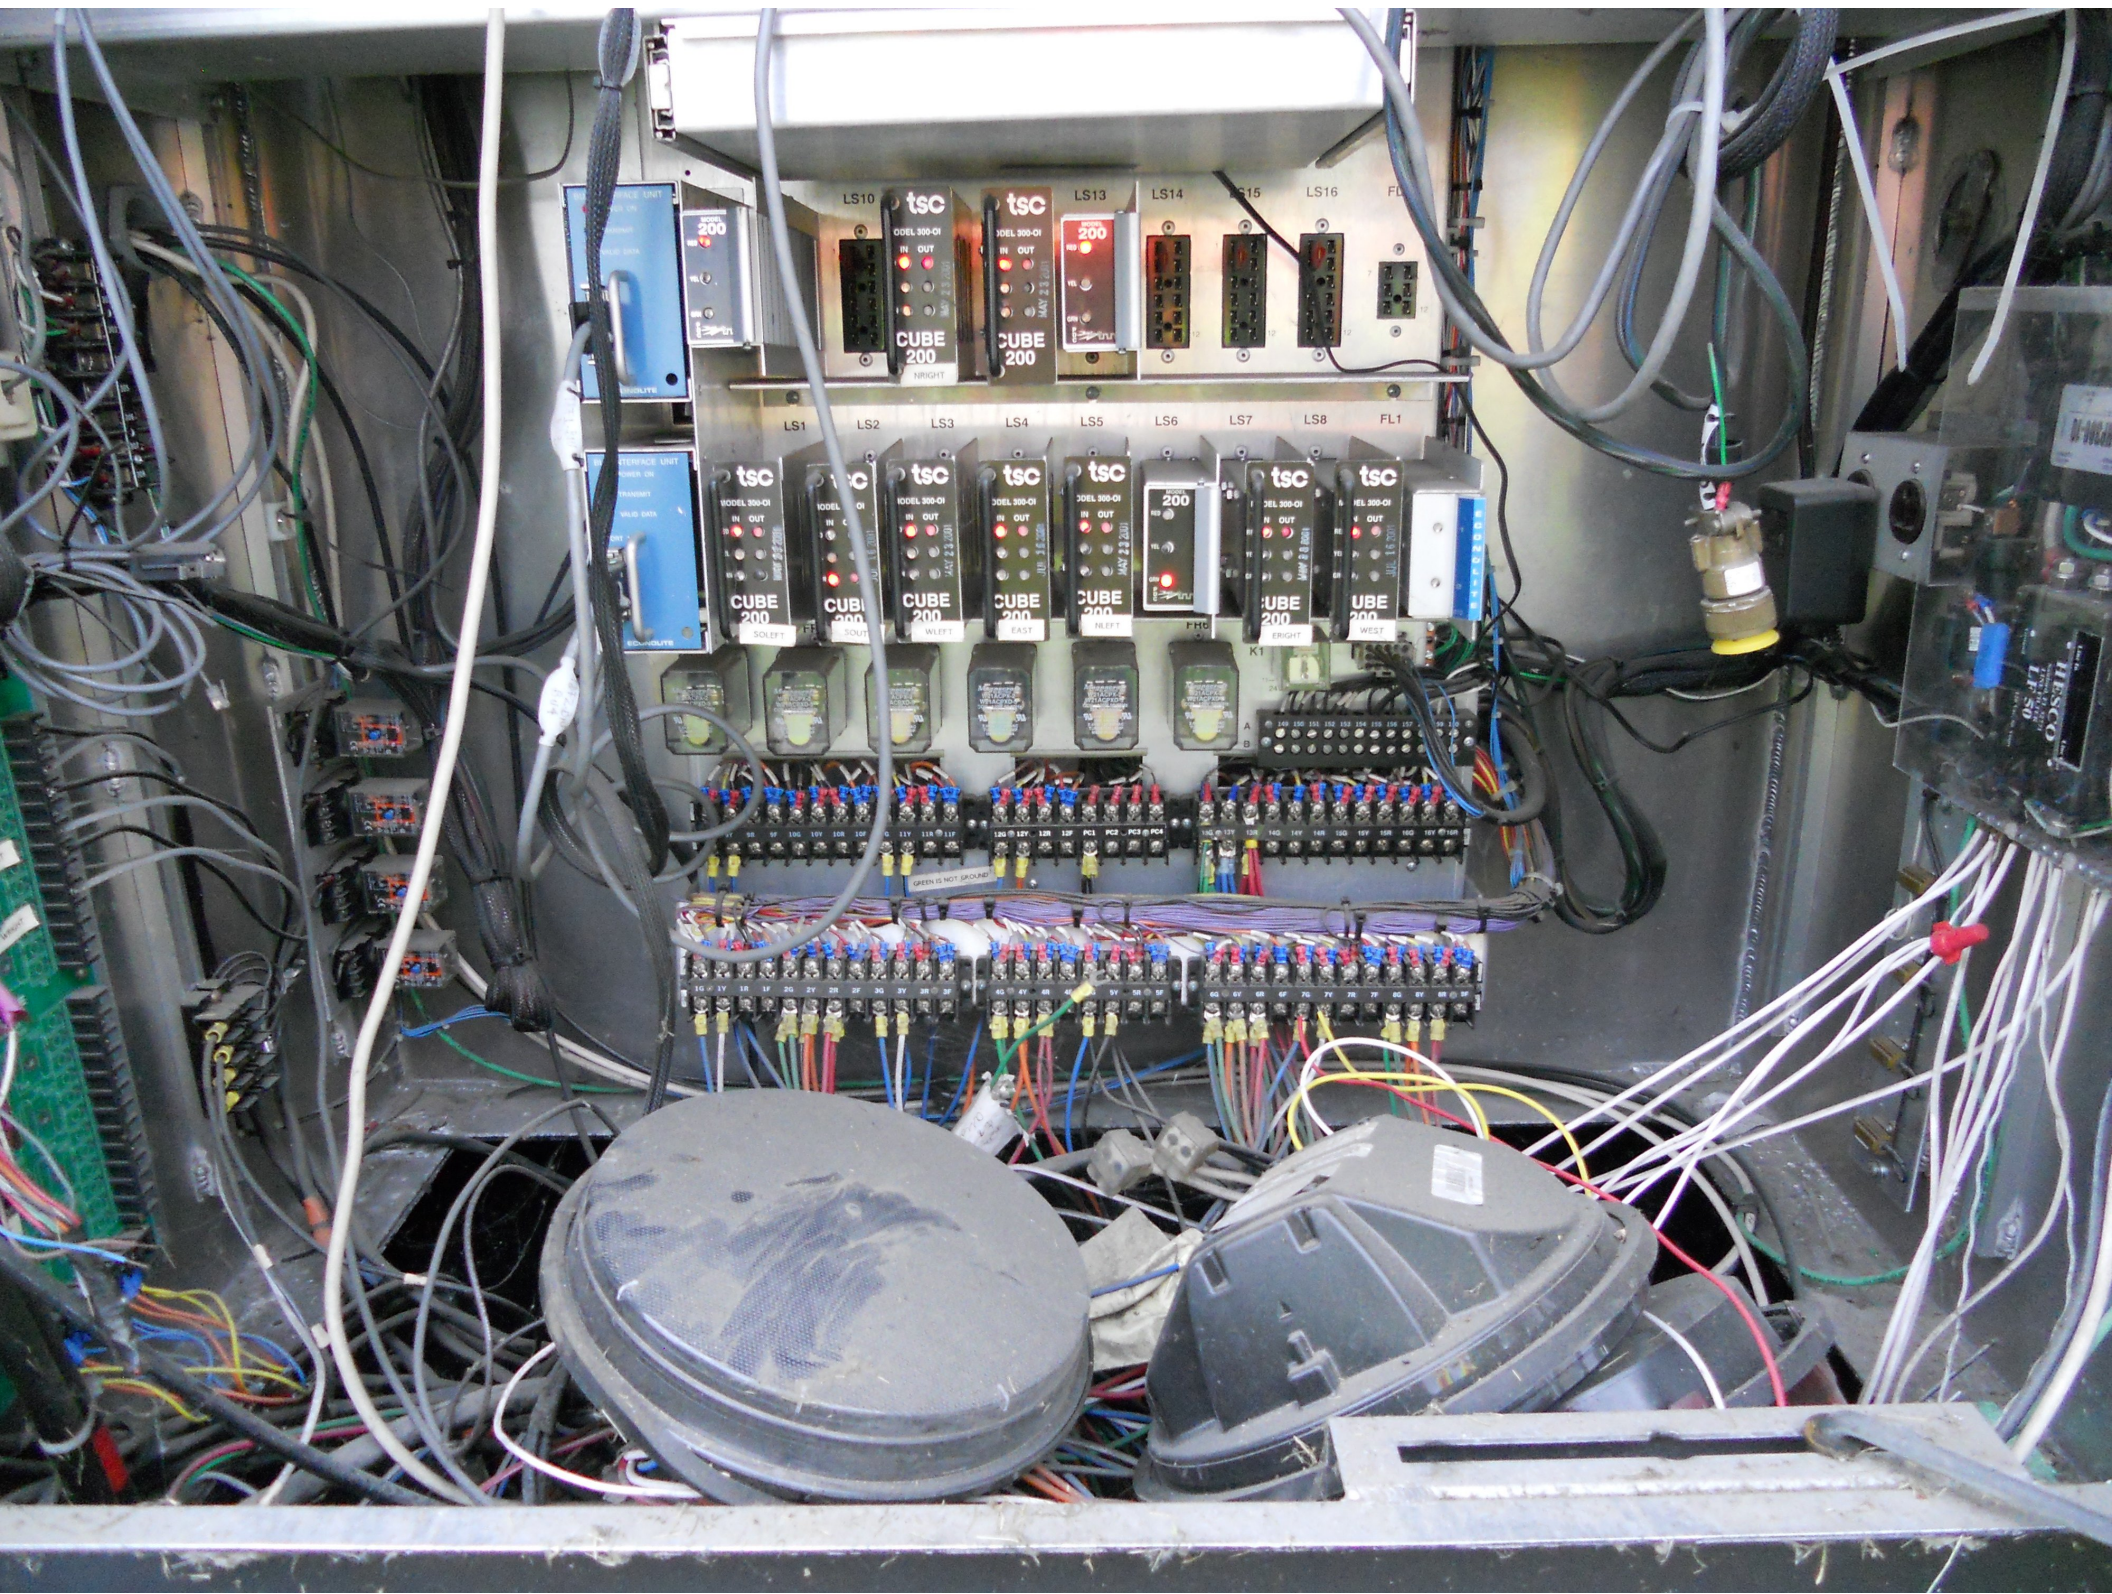

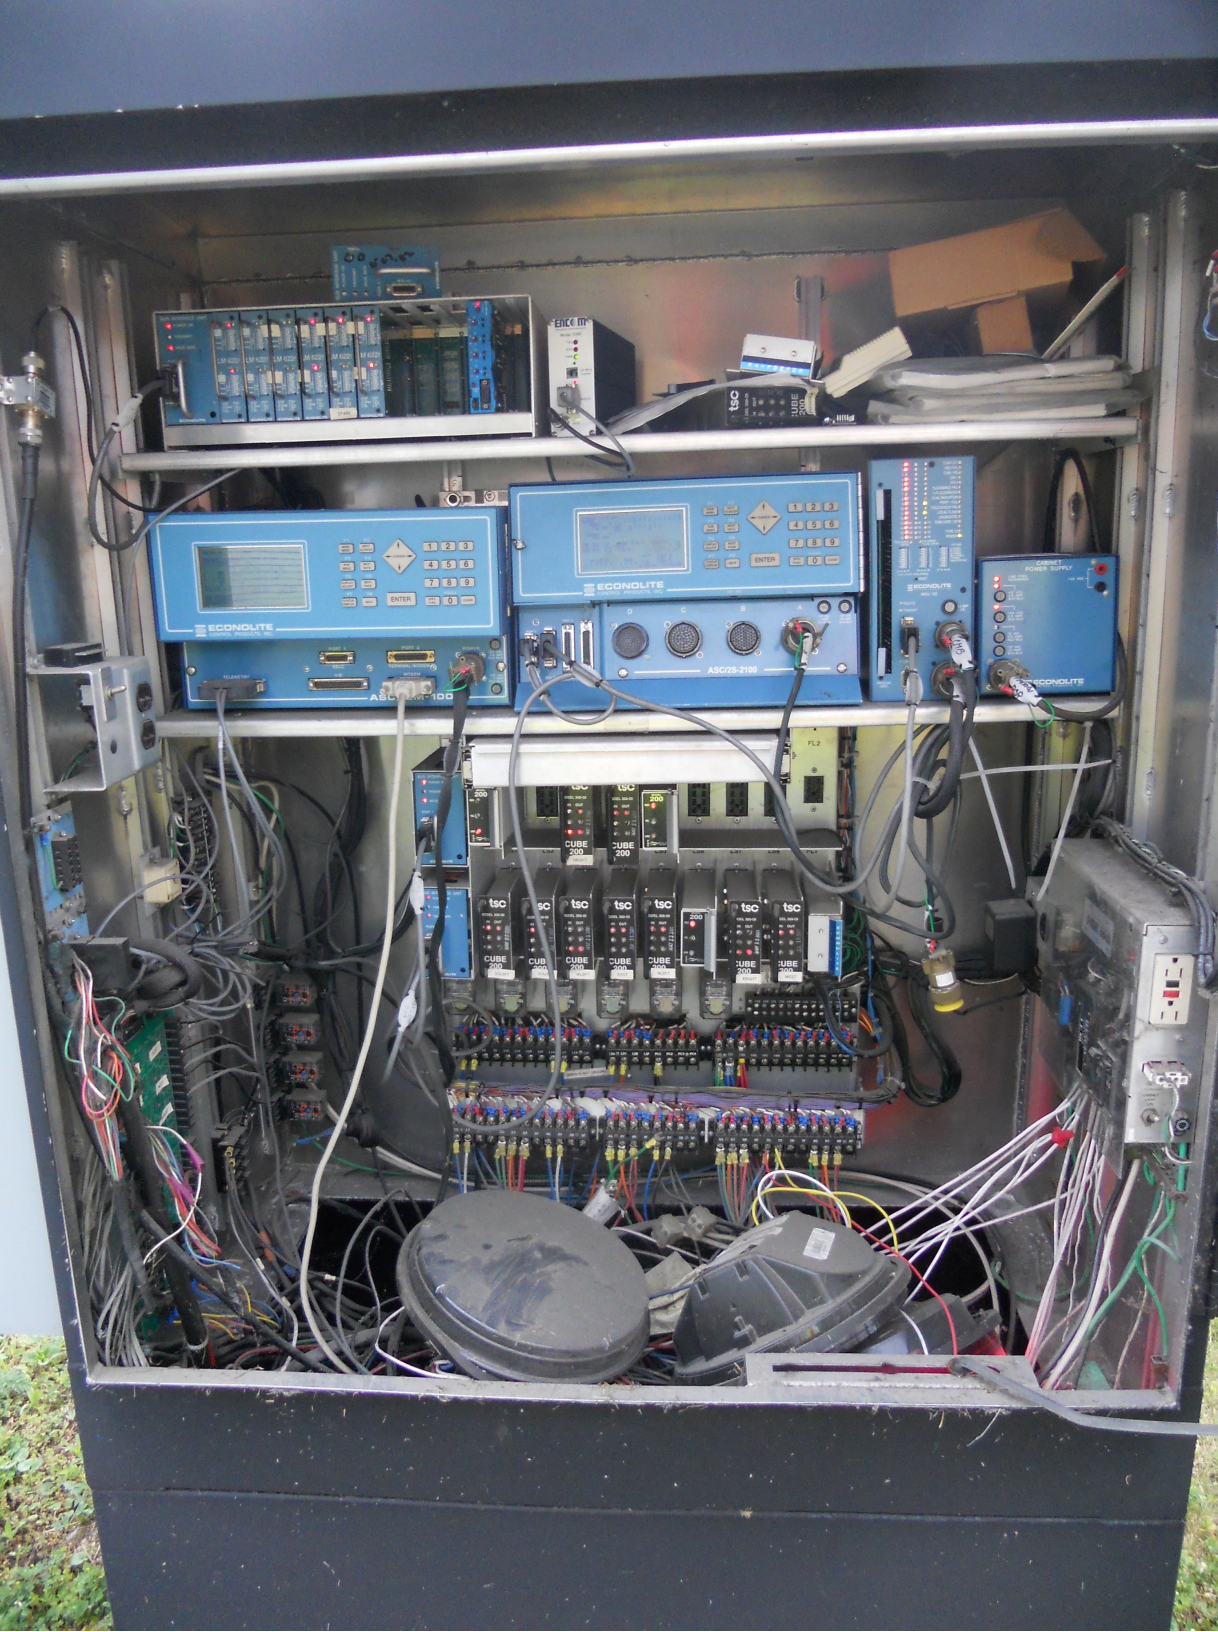





⚡ DANGER
HAZARD OF ELECTRICAL SHOCK
OR BURN IF COVER REMOVED
SERVICE BY UTILITY
AUTHORIZED PERSONNEL ONLY
DO NOT PAINT OVER OR REMOVE THIS LABEL
TYPED AND 10-11-1



































































100-10-2X3
55KST
2001
UNION METAL CORPORATION









TAFT
CORNERS



343

10

89

2-763



Mobil

3.64
3.79
3.94







35-13.0X27"
35-10.0X34"
55KSI
2001
UNION METAL CORPORATION



Dimming:

[illegible]

Coordination Patterns

Pattern 1

Cycle Length . . . 84 COS 111

Offset 0

Vehicle Permissive . . [1] 0 [2] 0

Vehicle Perm 2 Displacement 0 Phase Reservice. . NO

Splits: Phase 1- 11 2- 36 3- 13 4- 24

Phase 5- 16 6- 31 7- 11 8- 26

Phase 9- 22 10- 0 11- 0 12- 0 Split Sum: 0

Split Extension/Ring [1] 0 [2] 0

Split Demand Pattern [1] 0 [2] 0

XRT Pattern. . . 0

Phase Number: 1 2 3 4 5 6 7 8 9 10 11 12

Coord Phases . . . X . . . X

Veh Recall

Veh Max Recall

Ped Recall

Veh Omit

Alt Sequence . . A: . B: . C: . D: . E: . F: .

Pattern 2

Cycle Length . . . 88 COS 211

Offset 0

Vehicle Permissive . . [1] 0 [2] 0

Vehicle Perm 2 Displacement 0 Phase Reservice. . NO

Splits: Phase 1- 13 2- 37 3- 13 4- 25

Phase 5- 14 6- 36 7- 11 8- 27

Phase 9- 22 10- 0 11- 0 12- 0 Split Sum: 0

Split Extension/Ring [1] 0 [2] 0

Split Demand Pattern [1] 0 [2] 0

XRT Pattern. . . 0

Phase Number: 1 2 3 4 5 6 7 8 9 10 11 12

Coord Phases . . . X . . . X

Veh Recall

Veh Max Recall

Ped Recall

Veh Omit

Alt Sequence . . A: . B: . C: . D: . E: . F: .

Pattern 3

Cycle Length . . . 96 COS 311

Offset 0

Vehicle Permissive . . [1] 0 [2] 0

Vehicle Perm 2 Displacement 0 Phase Reservice. . NO

Splits: Phase 1- 14 2- 36 3- 12 4- 34

Phase 5- 18 6- 32 7- 11 8- 35

Phase 9- 22 10- 0 11- 0 12- 0 Split Sum: 0

Split Extension/Ring [1] 0 [2] 0

Split Demand Pattern [1] 0 [2] 0

XRT Pattern. . . 0

Phase Number: 1 2 3 4 5 6 7 8 9 10 11 12

Coord Phases . . . X . . . X

Veh Recall

Veh Max Recall

Ped Recall

Veh Omit

Alt Sequence . . A: . B: . C: . D: . E: . F: .

Coordination Patterns

Pattern 4
Cycle Length . . . 90 COS 411
Offset 0
Vehicle Permissive . . [1] 0 [2] 0
Vehicle Perm 2 Displacement 0 Phase Reservice. . NO
Splits: Phase 1- 14 2- 33 3- 14 4- 29
Phase 5- 17 6- 33 7- 14 8- 29
Phase 9- 0 10- 0 11- 0 12- 0 Split Sum: 0
Split Extension/Ring [1] 0 [2] 0
Split Demand Pattern [1] 0 [2] 0
XRT Pattern. . . 0
Phase Number: 1 2 3 4 5 6 7 8 9 10 11 12
Coord Phases . . . X . . . X
Veh Recall
Veh Max Recall
Ped Recall
Veh Omit
Alt Sequence . . A: . B: . C: . D: . E: . F: .

.....

	Week of Year																	
Prog	1 1	2 1	3 1	4 1	5 1	6 1	7 1	8 1	9 1	10 1	11 1	12 1	13 1	14 1	15 1	16 1	17 1	18 1
Prog	19 1	20 1	21 1	22 1	23 1	24 1	25 1	26 1	27 1	28 1	29 1	30 1	31 1	32 1	33 1	34 1	35 1	36 1
Prog	37 1	38 1	39 1	40 1	41 1	42 1	43 1	44 1	45 1	46 1	47 1	48 1	49 1	50 1	51 1	52 1	53 1	

NIC Program Steps

Step	Program	Step Begins	Pattern	Override
1	1	0600	1	NO
2	1	1000	2	NO
3	1	1430	3	NO
4	1	1900	2	NO
5	1	2200	0	NO
6	2	0600	1	NO
7	2	0900	3	NO
8	2	2200	0	NO

TOD Program Steps

Step 1 Program 1 Step Begins 0600

Flash.	Dimming Enable.
Red Rest	Alt Veh Extension
Spare 5.	Det Log Enable.
Spare 3.	Spare 4
Type 0 Dly Enable. . .	Spare 2
Det Diag Plan. . . . 0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	X	.	.	.	X	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

Step 2 Program 1 Step Begins 1000

Flash.	Dimming Enable.
Red Rest	Alt Veh Extension
Spare 5.	Det Log Enable.
Spare 3.	Spare 4
Type 0 Dly Enable. . .	Spare 2
Det Diag Plan. . . . 0	

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	X	X	X	X	X	X	X	X	X	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	X	.	.	.	X	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

TOD Program Steps

Step 3 Program 1 Step Begins 1430

Flash. Dimming Enable.
Red Rest Alt Veh Extension
Spare 5. Det Log Enable.
Spare 3. Spare 4
Type 0 Dly Enable. . . Spare 2
Det Diag Plan. . . . 0

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	X	X	X	X	X	X	X	X	X	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	X	.	.	.	X	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

Alt Sequence A B C D E F

Step 4 Program 1 Step Begins 1900

Flash. Dimming Enable.
Red Rest Alt Veh Extension
Spare 5. Det Log Enable.
Spare 3. Spare 4
Type 0 Dly Enable. . . Spare 2
Det Diag Plan. . . . 0

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	X	X	X	X	X	X	X	X	X	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	X	.	.	.	X	.	.	.	.	.	.
Veh Max Recall	.	.	.	.	.	.	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

Alt Sequence A B C D E F

TOD Program Steps

Step 5 Program 1 Step Begins 2200

Flash.	.	Dimming Enable.	.
Red Rest	.	Alt Veh Extension	.
Spare 5.	.	Det Log Enable.	.
Spare 3.	.	Spare 4	.
Type 0 Dly Enable. . .	.	Spare 2	.
Det Diag Plan.	0		

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	X	.	.	.	X	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

Step 6 Program 2 Step Begins 0600

Flash.	.	Dimming Enable.	.
Red Rest	.	Alt Veh Extension	.
Spare 5.	.	Det Log Enable.	.
Spare 3.	.	Spare 4	.
Type 0 Dly Enable. . .	.	Spare 2	.
Det Diag Plan.	0		

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	X	.	.	.	X	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

	A	B	C	D	E	F
Alt Sequence	.	.	.	.	.	.

TOD Program Steps

Step 7 Program 2 Step Begins 0900

Flash. Dimming Enable.
Red Rest Alt Veh Extension
Spare 5. Det Log Enable.
Spare 3. Spare 4
Type 0 Dly Enable. . . Spare 2
Det Diag Plan. . . . 0

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	X	X	X	X	X	X	X	X	X	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	X	.	.	.	X	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

Alt Sequence A B C D E F

Step 8 Program 2 Step Begins 2200

Flash. Dimming Enable.
Red Rest Alt Veh Extension
Spare 5. Det Log Enable.
Spare 3. Spare 4
Type 0 Dly Enable. . . Spare 2
Det Diag Plan. . . . 0

	Phase Number											
	1	2	3	4	5	6	7	8	9	10	11	12
Max 2 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Max 3 Enable	.	.	.	.	.	.	.	.	.	.	.	.
Veh Recall	.	.	.	.	.	.	.	.	.	.	.	.
Veh Max Recall	.	X	.	.	.	X	.	.	.	.	.	.
Ped Recall	.	.	.	.	.	.	.	.	.	.	.	.
Cond Service Inhibit.	.	.	.	.	.	.	.	.	.	.	.	.
Phase Omit	.	.	.	.	.	.	.	.	.	.	.	.
Special Function	.	.	.	.	.	.	.	.	.	.	.	.

Alt Sequence A B C D E F